GC SERIES

Counting Scale

INSTRUCTION MANUAL

GC-3K

GC-6K

GC-15K

GC-30K



Note for Precautions

To prevent accidents due to inappropriate handling, this manual contains the following warning signs and marks. The meanings of these warning signs and marks are as follows.

Warning Definitions

<u></u> ⚠ DANGER	An imminently hazardous situation that could result in death or serious injury, if not avoided.
⚠ WARNING	A potentially hazardous situation that could result in death or serious injury, if not avoided.
⚠ CAUTION	A potentially hazardous situation which, if not avoided, may result in personal injury or property damage.

Symbols Definitions

Â	\triangle indicates caution (including warning). A symbol inside the figure shows a specific content (in the case of the left figure, it is about electrical shock).
®	 ○ indicates prohibition. Specific content is shown in ○ or in terms and illustration near ○. In the case of the left figure, it is about "prohibition of disassembly".
0	 indicates something that must be followed. Specific content is shown in ● or in terms and illustration near ●. In the case of the left figure, it is about "something that must be followed".

Other

NOTE	The information that is helpful in using the device
------	---

Caution

- (1) No parts of this manual may be reproduced without permission. This manual may not be copied, modified, or translated without the written permission of A&D Company, Limited (hereinafter referred to as A&D). No parts or all of the contents in this manual may be reproduced without permission.
- (2) The contents of this manual are subject to change without notice.
- (3) Please contact A&D if you notice any uncertainty, errors, omissions, etc. in this manual.
- (4) A&D bears no liability for direct, indirect, special, or consequential damages due to the operation of this product, the claim of rights by third party, or for data loss, even if advised of the possibility of such damage regardless of (3) above.

© 2022 A&D Company, Limited

This manual may be reproduced or revised without permission of A&D. Product names and company names mentioned in this manual are trademarks or registered trademarks of their respective companies in Japan or other countries and regions.

Contents

1. COMPLIANCE	5
1.1. Compliance with FCC Rules	5
2. INTRODUCTION	5
3. OVERVIEW	5
4. PRECAUTIONS FOR USE	6
4.1. Precautions When Installing the Scale	6
4.2. Precautions When Weighing	6
4.3. Precautions for Storing	
5. UNPACKING	7
6. PART NAMES	
7. INSTALLATION	
8. BASIC OPERATION	
8.1. Basic Operation of the Scale	
8.2. Tare Subtraction	_
8.2.1. Set by Weighing a Tare	
8.2.2. Input a Tare Weight with the Keyboard	
8.2.3. Clear a Tare Weight	
9. COUNTING	
9.1. Prepare to Start Counting	
9.2. Back Up the Unit Weight	
9.3. Key Restriction Function	
9.4. Unit Weight by Sample	
9.5. Unit Weight by Keyboard	
9.6. Unit Weight by ID Number	
9.6.1. Search by ID Number	
9.6.2. Search by Item Code	
9.6.3. AIS Function	24
10.STORE UNIT WEIGHT	
10.1. Storing Unit Weight	26
10.2. Clearing a Stored Unit Weight	
10.3. Call Up Unit Weight Together with Tare Weight	
10.4. Call Up Unit Weight Together with Comparator Upper Limit Value and Lower Limit Value	
10.5. Call Up Unit Weight Together with Comparator Upper Limit Value, Lower Limit Value, and Tare Weight	
11.TOTAL (M+) FUNCTION	
11.1. Total (M+) Function	30
11.2. Viewing the Total Count	
11.3. Clearing the Total Count	
11.4. Subtraction (M-) Function	31
11.5. Calling Up Unit Weight and Total Count Together	
12.COMPARATOR FUNCTION	
12.1. Setting the Comparator	32
12.2. Comparison Relation	
12.3. Setting Upper Limits and Lower Limits	33

	34
13.1. Preparing for Sensitivity Adjustment	34
13.2. Sensitivity Adjustment Using a Weight	35
13.3. Correcting Gravity Acceleration	36
13.4. Initializing Sensitivity Adjustment Value	36
14.FUNCTIONS	37
14.1. Function Setting	37
14.2. Function List	38
14.3. Password Lock Function	45
14.3.1. Password Registration	45
14.3.2. Function Setting after Password Lock	46
14.3.3. If You Forget Your Password	47
14.4. Initialization of Function Settings	47
15.ACAI	48
15.1. ACAI Function	48
15.2. Automatic Operation of ACAI	48
15.3. Manual Operation of ACAI	49
16.COMMUNICATION SPECIFICATIONS	50
16.1. RS-232C Interface	50
16.2. Communication Mode	51
16.3. Commands	55
16.4. UFC (Universal Flex Coms) Function	62
17.SD	65
17.1. Usable Type of SD Card	65
17.2. Data Format	65
17.3. Inserting SD Card	67
17.4. Copying Data	68
18.OPTIONS	
18.1. Options List	69
18.2. AD-8561	
18.2.1. Input With Barcode Reader/Keyboard	69
18.2.2. Comparator Relay Output	69
18.2.3. Interface for Remote Scale	70
18.3. Separation of Display/GC-08	
18.3.1. Separation of Display	72
18.3.2. Attachment of GC-08	72
19.MAINTENANCE	73
19.1. Repair	
19.2. Troubleshooting	
19.3. Error Display	
20.SPECIFICATIONS	
20.1. Specifications List	
20.2. External Dimensions	76
20.3. Gravity Acceleration Map	77



1. Compliance

1.1. Compliance with FCC Rules

Please note that this equipment generates, uses and can radiate radio frequency energy. This equipment has been tested and has been found to comply with the limits of a Class A computing device pursuant to Subpart J of Part 15 of FCC rules. These rules are designed to provide reasonable protection against interference when this equipment is operated in a commercial environment. If this unit is operated in a residential area, it might cause some interference and under these circumstances the user would be required to take, at his own expense, whatever measures are necessary to eliminate the interference.

(FCC = Federal Communications Commission in the U.S.A.)



Introduction

Thank you for purchasing a GC series counting scale. This manual describes how the GC series counting scale works. For effective use, read this instruction manual thoroughly before using the product.



Overview

This product has the following characteristics.

- □ Counting scales with display resolution 1/6000 to 1/7500.
- □ When counting the number of pieces that have the same weight, the number can be calculated from the weight (unit weight) of one piece.
- □ Unit weight can be set in various ways as follows.
 - Weigh the total weight of samples for which quantity is specified such as five, ten, etc.
 - Weigh the total weight of samples for which quantity is arbitrary.
 - Input a known unit weight with a keyboard.
 - Call up the unit weight that is stored in internal memory or external memory (micro SD card).
 - Set externally such as with a computer.
- □ Unit weight can be easily set according to the status of LED blinking.
- With ACAI (Automatic Counting Accuracy Improvement), counting with accurate unit weight is possible.
- □ In internal memory, unit weight up to 1000, item code, tare weight, total count, and comparator upper and lower limits can be stored together with the ID.
- □ For the item code, upper-case/lower-case alphabet and numeric digits are usable.
- □ The M+ function adds the counting results.
- □ The comparator function compares upper and lower limits that have been set with the counted value or weighed value. The result is shown as LO, OK, and HI (red, green, and yellow).
- □ The display can be separated from the main scale.
- □ For the power, an AC adapter or commercial mobile battery is usable.
- □ With the RS-232C cable or AD-8561 (Multi-Interface), weighing data and counting data can be sent to a computer.



4. Precautions for Use

4.1. Precautions When Installing the Scale

DANGER

- Do not touch the AC adaptor with wet hands. Doing so may cause electric shock.
- Do not install the scale in a location where corrosive gas or flammable gas are present.

∕NWARNING

- Do not apply excessive load to the cable.
- The scale is heavy. Use caution when lifting, moving and carrying the scale. Do not lift the scale by holding the display unit or weighing pan. Doing so may cause the product to fall and be damaged. Hold the bottom side of the base unit when lifting, moving and carrying the scale.
- Use the scale indoors. If used outdoors, the scale may be subjected to lightning surges that exceed the discharge capacity. It may not be able to withstand the energy of the lightning and may be damaged.

Consider the following installation conditions in order to obtain the proper performance.

- The ideal conditions for installation are stable temperature and humidity, solid and level surface, location with no draft or vibration, indoors out of direct sunlight and a stable power supply.
- □ Do not install the scale on a soft floor or where there is vibration.
- Do not install the scale in location where breezes or large fluctuations in temperature occur.
- Avoid locations in direct sunlight.
- Do not install in a location with strong magnetic fields or strong radio signals.
- Do not install the scale in a location where static electricity is likely to occur. When humidity is 45% R.H. or less, plastic and insulating materials are susceptible to being charged with static electricity due to friction, etc.
- □ The scale is not dustproof or waterproof. Install the scale in a location where it will not become wet.
- When the AC adapter is connected to an unstable AC power supply, it may malfunction.
- □ Turn on the scale using the ON/OFF key and keep the weighing display on for at least 30 minutes before use.

4.2. Precautions When Weighing


- Do not place a load exceeding the weighing capacity on the weighing pan.
- Do not apply shock to or drop anything on the weighing pan.
- Do not use a sharp instrument such as a pen to press switches.
- Press the ZERO | key before each weighing to reduce weighing errors.
- Periodically confirm that weighing values are correct.

4.3. Precautions for Storing

- Do not disassemble the scale.
- Wipe using a soft cloth slightly moistened with a mild detergent when cleaning the scale. Do not use organic solvents. Using organic solvents such as MEK may cause the display to become so opaque that it cannot be properly seen.
- Prevent water, dust and other foreign materials from getting into the scale.
- Do not scrub with a brush or the like.




The following items are included in the package.

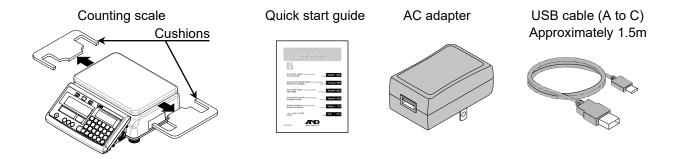


Remove the cushions under the weighing pan
 (Put the cushions back under the weighing pan when transporting the scale to another place).



6. Part Names

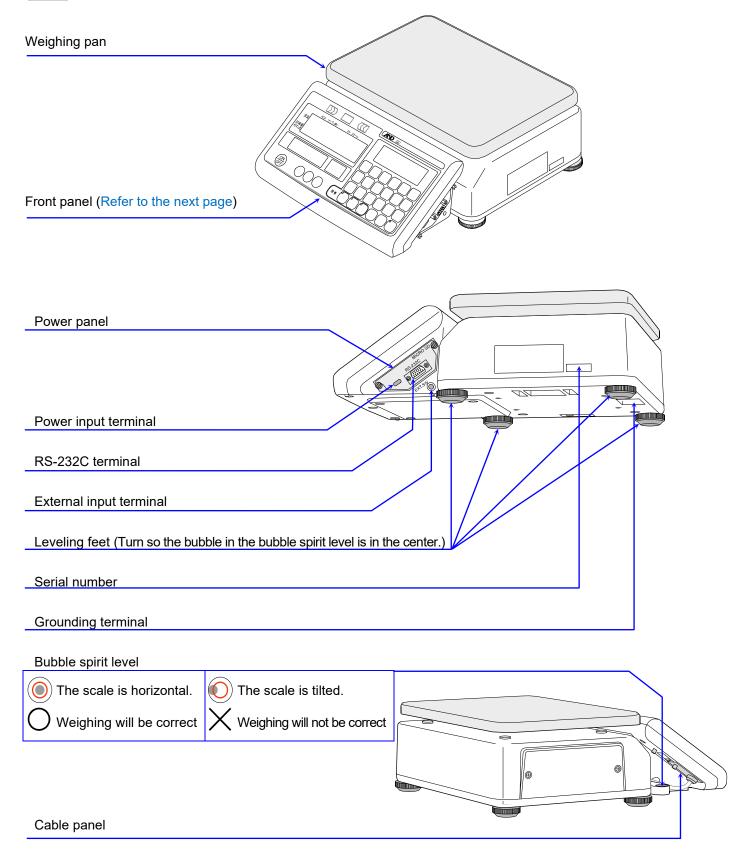


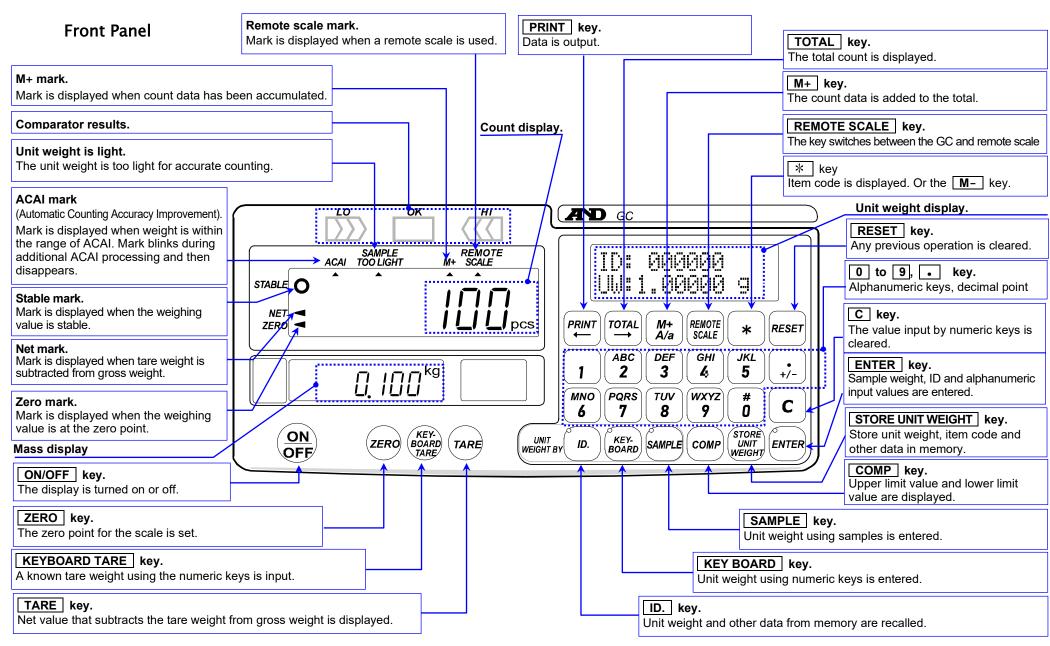




7. Installation

 
 Adjust the horizontal level of the product using the four leveling feet and bubble spirit level. Confirm that the scale is seated firmly and does not rattle (refer to "4.1. Precautions When Installing the Scale").




Bubble spirit level

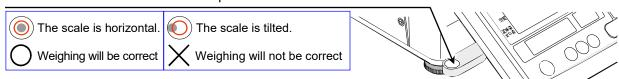

- Perform sensitivity adjustment when the scale is installed for the first time or relocated (refer to "13. Sensitivity Adjustment").
- Ground the scale by using the grounding terminal when it is used where static electricity occurs.
- 2. Connect the AC adapter to an outlet, and the USB cable to the power input terminal that is on the side of display.

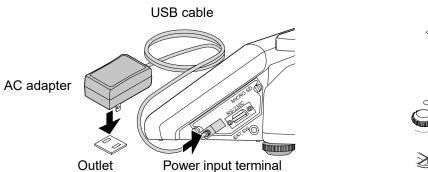

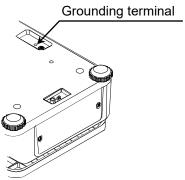

- Performance is not guaranteed if a commercial AC adapter or a USB cable for other products is used.
- □ When using a mobile battery as a power source, it is recommended that you use one where power can be turned on/off with a switch.
- Set function setting F D Y D B to " + " if the mobile battery has an automatic power-off function (Operating time will be shortened) (refer to "14. Functions").
- The table below shows the reference values of continuously usable time with mobile batteries (comparator function being off, no connected devices).

Continuously usable time			
5000 mAh	10000 mAh		
Approximately 24 hours	Approximately 50 hours		

- Performance is not guaranteed with all mobile batteries.
- Confirm the specifications of mobile batteries before use. Product damage due to mobile batteries will void the warranty.
- Please confirm that the local voltage and the receptacle type are correct for your scale.

⚠CAUTION

- □ The power input terminal cannot perform data communication.
- □ The power input terminal cannot output power.
- □ Do not connect to any device other than a power source, otherwise the product may be damaged.



8. Basic Operation

8.1. Basic Operation of the Scale

Press the ON/OFF key to turn the power on.

Press the ON/OFF key again to turn the power off.

- Although the display can be turned off with the ON/OFF key, the internal circuit stays energized.
- 1. Turn the power on without placing anything on the weighing pan.
- 2. After all the display indicators turn on, the scale displays zero.
- 3. If the display does not show zero, press the ZERO key.
 - If the weighing value does not become stable, " Errar!" is shown. Confirm whether there is something touching the weighing pan, or a strong breeze or vibration can be observed.





Zero-Point Setting

The ZERO key sets a zero point when the weighing value is stable within ± 2% of weighing capacity based on basing the zero point (power-on zero) when the display turns on. The scale displays zero, and the zero-point mark lights up.

Tare Subtraction

The TARE key subtracts the weight of substance on the weighing pan as the weight of tare (container) when the weighing value is stable and more than zero. The scale displays zero, and the net weight mark and zero-point mark light.

Caution: The weighing range is reduced by the tare weight.

Power-On Zero

When the ON/OFF key is pressed to turn on the display with nothing on the weighing pan, the scale displays zero together with the zero-point mark lit. The range in which power-on zero is run is less than ± 50% of the weighing capacity for zero with sensitivity adjustment.

Power-On Tare

When the $\boxed{\text{ON/OFF}}$ key is pressed to turn on the display with something on the weighing pan, tare subtraction is run to light the net weight mark and the zero-point mark and to show zero. The range in which power-on tare subtraction is run is \pm 50% or more of the weighing capacity.

*Less than ± 50% of the weighing capacity: Power-on zero (zero-point mark lighting)

*± 50% or more of the weighing capacity: Power-on tare subtraction (net weight and zero-point marks lit)

Near Zero

Near zero is the range within \pm 4d in kg (d = minimum display). This range is regarded as the standard for functions being operated/not operated with comparators, etc.

8.2. Tare Subtraction

Tare subtraction is performed when weighing/counting with a tare (container) to subtract the weight of the tare (container) and display the net value. There are the following two ways to set the tare weight.

- Weigh the actual tare weight to set:


Refer to "8.2.1. Set by Weighing a Tare"

- Input the known tare weight with the keyboard

Refer to "8.2.2. Input a Tare Weight with the Keyboard"

8.2.1. Set by Weighing a Tare

- 1. Place a tare (container) alone on the weighing pan and press the TARE key.
- 2. The scale displays "-----". Wait until the weighing value becomes stable.
- The scale subtracts the weight of the tare and displays the net weight. The zero-point mark and the net weight mark light up.

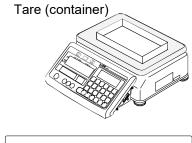



8.2.2. Input a Tare Weight with the Keyboard

- 1. Remove everything from the weighing pan. If the display does not show zero, press the ZERO key to show zero.
- 2. Press the KEYBOARD TARE key. The weight display blinks.





3. Use the numeric keys 0 to 9 to input a tare weight. To correct the value, press the C key and re-enter the weight.

(The figure to the right shows an example of 615g tare weight.)



4. Press the ENTER key.

The tare weight is subtracted and the scale displays the net weight. The net weight mark lights up.

The values that are entered with numerical keys are rounded off to the minimum display of weight. For example, if entering 123 g with the GC-30K, which has minimum display of 5 g, the tare weight is shown as 125 g.





8.2.3. Clear a Tare Weight

1. Remove everything from the weighing pan.

There are the following two ways to clear a tare weight.

Perform a Tare Subtraction at the Zero-Point

2.	Press the TARE key.
	The tare weight is cleared and the scale displays zero. The net weight mark disappears.

□ If the display does not show zero, press the ZERO key to make it show zero.

Input Zero for the Tare Weight


- 1. Remove everything from the weighing pan.
- 2. Press the KEYBOARD TARE key. The weight display blinks.
- 3. Input "0" for the tare weight and press the ENTER key. The tare weight is cleared and the scale displays zero. The net weight disappears.
 - □ If the display does not show zero, press the ZERO key to make it show zero.



9.1. Prepare to Start Counting

For counting, the weight per one item (unit weight) needs to be set.

- 1. Press the ON/OFF key to turn on the display. Or press the RESET key to initialize the previous operation.
- 2. Three LED lights in the unit weight panel blink and the unit weight setting is activated. This is the default status before counting.
- 3. Choose one of the following options to set the unit weight for counting, or bring up one from the memory.

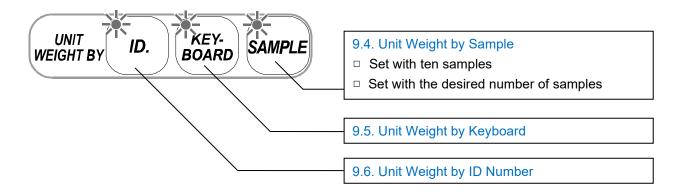

NOTE


Press the RESET key to return to the default status above whenever you suspend the operation or are uncertain about the ongoing operation. This does not clear the tare weight, total count, upper limit/lower limit of comparator.

RESET

9.2. Back Up the Unit Weight

The unit weight in use is stored in the internal memory. If the unit weight is reset or the power is turned off accidentally, the memory can be brought up from "ID: 000000" as follows.


- 1. The three LED lights in the unit weight panel should be blinking.
- 2. Press the ID. key.
 The scale displays "ID: 000000".

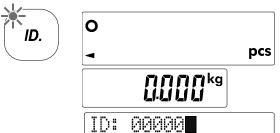

Load Data

3. Press the ENTER key.

The unit weight that was previously used is called up.

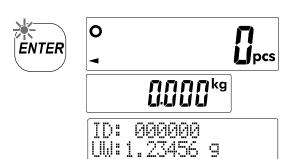

Automatically Call Up the Previous Unit Weight

 
The unit weight that was previously used can be called up when the display is turned on.

 \Box Set function setting $F - \Box I - \Box I = \Box I =$

9.3. Key Restriction Function

This function restricts key operation. If this function is activated, only the keys used for "9.4. Unit Weight by Sample" become usable.

Keys usable when the key operation is restricted




- □ Set function setting F-□ |-□ | to "|" to enable this function (refer to "14. Functions").
- □ Note that all functions that use keys other than the above are disabled.

9.4. Unit Weight by Sample

Setting With Ten Samples

1. Press the RESET key. The three LED lights in the unit weight panel blink. If you use a tare (container), place it on the center of weighing pan.

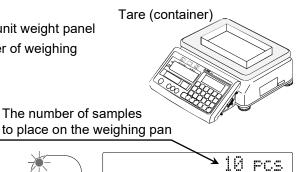


Add

Sample


2. Press the SAMPLE key.

The scale automatically performs tare subtraction with a tare (container) and displays "Add Sample" and "10 pcs."

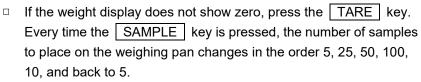

□ The greater the number of samples is, the higher the accuracy of the unit weight becomes.

 
3. Place the number of samples that is shown in the display on the weighing pan (or put it in a container).






SAMPLE

4. Press the ENTER key. After showing "-----", the scale displays count, total weight, and unit weight.

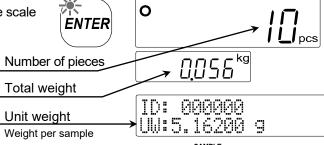


0

- If the weight of samples in use is not heavy enough to determine the unit weight (the total weight of samples is not 10.1 times as heavy as the minimum display), the scale displays the number of samples to add together with "Add" (insufficient samples). Add the number of samples accordingly, and then press the ENTER key.
- □ The unit weight is settable even if the ENTER key is pressed without additional samples. However, counting accuracy may not be sufficient.
- 5. You may begin counting operations using the unit weight entered.

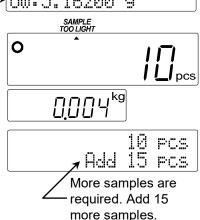

Desired Sample Size

 - 1. Press the RESET key. The three LED lights in the unit weight panel blink. If you use a tare (container), place it on the center of weighing pan.
- 2. Press the SAMPLE key. The scale automatically performs tare subtraction operation with a tare (container) and displays "10pcs" and "Add Sample".
 - If the weight display does not show zero, press the TARE key.




Add Sample


Tare (container)

The number of samples to place on the weighing pan

- 3. Use the numeric keys 0 to 9 to input the desired number of samples (The figure to the right shows an example of 20 samples).
 - If you pressed the wrong key or want to make corrections, press the C key.
- 4. Place the number of samples input on the weighing pan (or put it in the container).

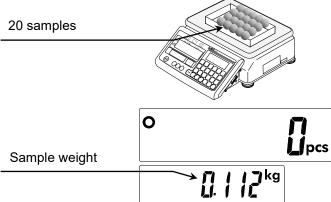


- 5. Press the **ENTER** key. After showing "-----", the scale displays count, total weight, and unit weight.
 - If the weight of samples in use is not heavy enough to determine the unit weight (the total weight of samples is not 10.1 times as heavy as the minimum display), the scale displays the number of samples to add together with "Add" (insufficient samples). Add the number of samples accordingly, and press the ENTER key.
 - The unit weight is settable even if the ENTER key is pressed without additional samples. However, counting accuracy may not be sufficient.
- 6. You may begin counting operations using the unit weight entered.

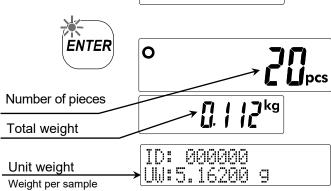

9.5. Unit Weight by Keyboard

1. Press the RESET key. The three LED lights in the unit weight panel blink. If you use a tare (container), place it on the center of the weighing pan and press the TARE key.



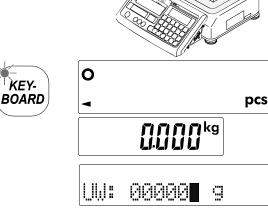


Tare (container)

3. Use the numeric keys 0 to 9 to input a known unit weight. (The figure to the right shows an example of 32 g).



4. Press the ENTER key. The unit weight input is set.

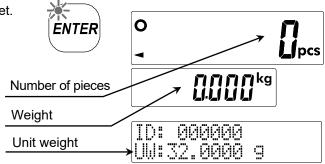

If the unit weight that has been input is excessively light (less than minimum countable unit weight), the scale displays "Low Unit Weight" and returns to Step 3. Input the unit weight again.




5. You may begin counting operations using the unit weight entered.


9.6. Unit Weight by ID Number

The following explains how to call up a unit weight that is stored in internal or external memory. Set function setting $F - \Omega B - \Omega Z$ to internal memory "U" or external memory "U" or external memory "U" (refer to "14. Functions").

- With internal memory, the unit weight needs to be stored in advance (refer to "10.1. Storing Unit Weight").
- With external memory, a file in the corresponding format must be prepared (refer to "17. SD").

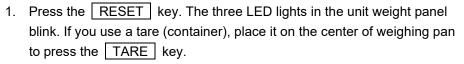

2. Press the ID. key. The scale displays "ID: 000000".

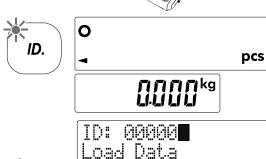


Tare (container)

3. ID or item code is selectable as a search key. Also, the AIS function, which calls up unit weight that is closest to the current weighing value, is available. Press the ID. key to switch the search key.

ID search
Refer to "9.6.1. Search by ID Number"
Item code search
Refer to "9.6.2. Search by Item Code"

- AIS function : Refer to "9.6.3. AIS Function"

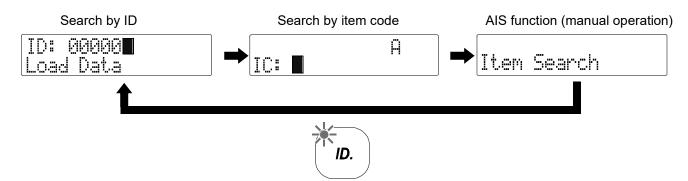


9.6.1. Search by ID Number


1. Use the numeric keys 0 to 9 to input the ID to call up (The figure to the right shows an example of ID: 123456).




- If you pressed the wrong key or want to make corrections, press the C key.
- 2. Press the ENTER key. The unit weight stored in the ID entered is called up.

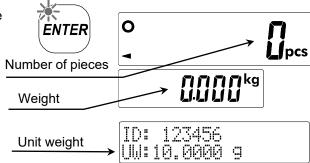

 □ When the ID entered does not exist, the scale displays "No Data" and returns to Step 1.



Press the $\boxed{*}$ key. ID and item code (IC) are switched.

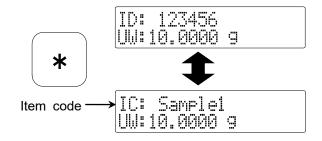


3. You may begin counting operations using the unit weight called up.

NOTE

- "ID: 000000" is for backup. The unit weight that was previously used is automatically stored.
- □ When unit weight is set, it is automatically stored in "ID: 000000".
- Even if unit weight is cleared with the RESET key, it can be called up from "ID: 000000".

9.6.2. Search by Item Code

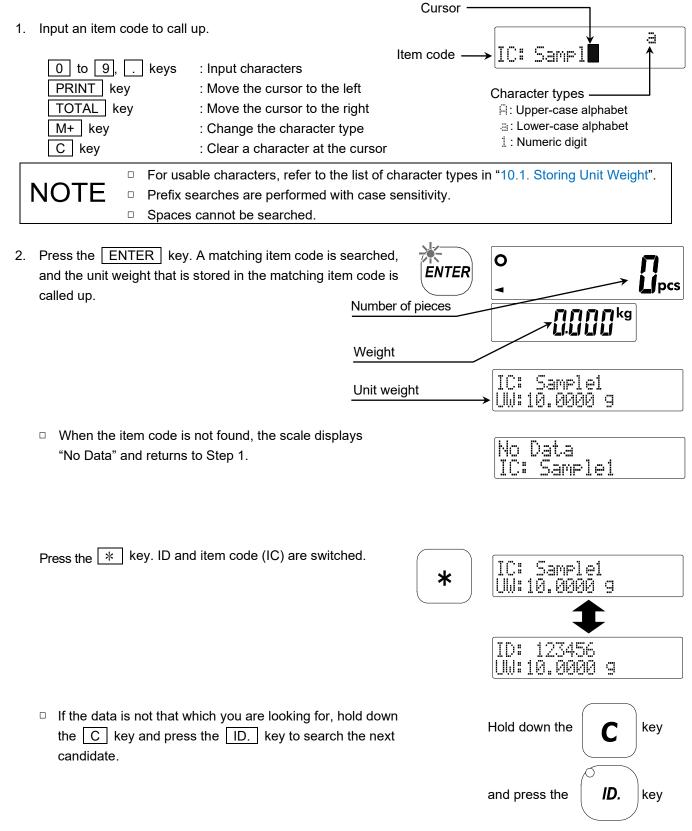

3. You may begin counting operations using the unit weight called up.

List of errors during memory access

Display	Description		
No Data	- ID or item code entered does not exist.		
	- The capacity of internal memory is full, and the data cannot be stored. Delete		
Full Data unnecessary data and free up storage space (refer to "10.2. Clearing a Sto			
	Weight").		
Format Error	rror - The data format of external memory is wrong. Check the data format (refer to "17. SD"		
	- External memory cannot be detected. Insert external memory (refer to "17. SD").		
Not Detected	- External memory file cannot be found. Check the file name and file format (refer		
	to "17. SD").		

9.6.3. **AIS Function**

AIS (Automatic Item Search) calls up a unit weight that is close to the current weighing value by searching memory. With this function, items can be individually identified.


- To use this function, the unit weight needs to be stored in advance.
- The function is usable when the unit weight is heavier than near-zero (within ± 4d in kg).
- Performing counting operations with inappropriate item data called up causes incorrect results. Make sure that the data called up is that for the appropriate item.
- Set function setting $F \Omega I \Omega S$ to "I" (refer to "14. Functions"). 0 2. Place nothing on the weighing pan. If the scale does not display the weight as zero, press the ZERO key to make it display zero. 3. Place one sample to count on the weighing pan. 0 The current weighing value 4. The scale automatically searches and calls up a unit Item code •IC: Sample1 weight that is close to the current unit weight. Check ∤UW:10.0000 g
 - With internal memory, 10 data that are closer to the weighing value within approximately 5% from the value become candidates.

Unit weight

- With external memory, the data that is within approximately 5% from the weighing value becomes a candidate.
- 5. You may begin counting operations using the unit weight called up.

the item code (IC) and unit weight. Press the * key, and the display of ID and item code is switched.

□ If the data is not that which you are looking for, hold down the C key and press the ID. key to display the next candidate.

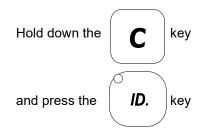

When data that is close to weighing value is not found, the scale displays "No Data".

No Data Item Search

□ To re-search

Make sure that the scale displays "Item Search", and place the item on the weighing pan again. Press the ENTER key, and re-search starts.

With internal memory, data that has the same unit weight becomes candidates in the order it is located in internal memory. When there is multiple data that has the same or close unit weight, note that the data to be found may not be a candidate.

Manual Operation

 
- 1. Place nothing on the weighing pan. If the scale does not display the weight as zero, press the ZERO key to make it display zero.
- 2. Follow Step 3 in "9.6. Unit Weight by ID Number" to display "Item Search".

3. Place one sample to count to the weighing pan.






4. Press the ENTER key. The scale searches and calls up a unit weight that is close to the current weighing value.



 
 A unit weight that is close to the weighing value is called up. Check the item code (IC) and unit weight.
 Press the * key. ID and item code (IC) are switched.



- With internal memory, 10 data that are closer to the weighing value within approximately 5% from the value become candidates.
- □ With external memory, the data that is within approximately 5 % from weighing value becomes a candidate.

6. You may begin counting operations using the unit weight called up.

If the data is not that which you are looking for, hold down the
 C key and press the ID. key to display the next candidate.

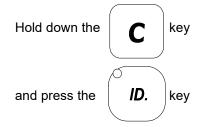



10. Store Unit Weight

10.1. Storing Unit Weight

1000 types of unit weight can be stored in internal memory together with 6-digit ID (selectable from 000001 to 999999). 20-letter item code (IC) is added to the ID.

1. Set up unit weight in advance to make the scale countable. Refer to "9.4. Unit Weight by Sample" or "9.5. Unit Weight by Keyboard".



2. Press the STORE UNIT WEIGHT key. The scale displays "ID: 000000".



ENTER

ID: 00000 Save Data

- 3. Use the numeric keys 0 to 9 to input an ID (the figure to the right shows an example of ID: 123456).
 - □ "ID: 000000" is for backup and therefore cannot be used.
 - If you pressed the wrong key or want to make corrections, press the | C | key.




4. Press the ENTER key. An item code can be input, and the character type and cursor are shown.

The item code can be input with the following keys. The item code should be up to 20 letters, and upper-case/lower-case alphabet, numeric digits, and symbols are usable.

0 to 9, : Input characters

PRINT key : Move the cursor to the left TOTAL key : Move the cursor to the right M+ key : Change the character type : Clear a character at the cursor C key

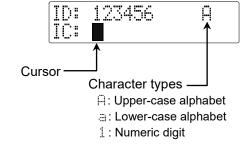

- If you press the | ENTER | key again without inputting an item code, the unit weight is stored without an item code.
- Press the | STORE UNIT WEIGHT | key to input an ID as described in Step 3.

List of character types

Alphabet				
Key	Alphabet		Numeric digit	
,	□ (upper case)	≅ (lower case)	ŭ .	
1	a []	~ <u></u>	1	
2	ABC	аЬс	2	
3	DEF	9 0	3	
4	G H I	9 h i	4	
5	JKL	j k l	5	
6	MHO	m n o	6	
7	PQRS	p a r s	7	
8	TUV	tuv	8	
9	WXYZ	$w \times y z$	9	
0	# \$ % & ? () * + ,		Ø	
·	/ ! " : ; < = > ?			
С	Clear (input blank)			

5. Press the ENTER key.

The scale stores the ID entered and returns to counting.



ID: 123456 a IC: Samplei∎

 If a unit weight is already stored in the ID entered, the scale displays a confirmation message if it will be overwritten.

 
- Overwrite : Press the ENTER key.

- Do not overwrite : Press the STORE UNIT WEIGHT

key to return to Step 3. Input a different

ID and item code.

6. Press the * key to switch the display between ID and item code. Check the item code.







IC: Sample1 UW:10.0000 9



10.2. Clearing a Stored Unit Weight

To clear an ID data stored in internal memory, perform the following operation. Hold down the key 1. Hold down the C key and press the ID key. The scale displays "ID: 000000". ID. and press the key - To clear specific ID data : Step 2 - To clear all ID data : Step 4 ID: 00000 Clear Data Clearing Specific ID Data 2. Use the numeric keys 0 to 9 to input the ID to clear (the figure to the right shows an example of ID: 123456). □ "ID: 000000" is for backup. If you pressed the wrong key or want to make corrections, press the C key. 3. Press the ENTER key. The scale clears the specified ID data and returns to the previous display. If the ID specified does not exist, return to Step 2. Either input a different ID or press the RESET key to finish. Clearing All ID Data **TOTAL** 4. Press the TOTAL key. The scale displays "ID: ALL". 5. Press the ENTER key. The scale displays ID: ALL Clear "ID: ALL Clear". Clear Data 6. Press the ENTER key again. The scale clears all ID data and returns to the previous display.

If not clearing all ID data, press the RESET key to finish.

or

RESET

10.3. Call Up Unit Weight Together with Tare Weight

- 1. Set function setting F-08-0 / to " 00 / " (refer to "14. Functions").
- 2. Refer to "8.2. Tare Subtraction" to set the tare.
- 3. With the steps described in "10.1. Storing Unit Weight", unit weight and tare are stored together.
 - □ To additionally make an ID to which unit weight has already been registered store tare, call up the ID in advance and perform step 2 and 3.
- 4. With the steps described in "9.6. Unit Weight by ID Number", unit weight and tare are called up together.

10.4. Call Up Unit Weight Together with Comparator Upper Limit Value and Lower Limit Value

- 1. Set function setting $F \square B \square I$ to " $\square I \square$ " (refer to "14. Functions").
- 2. Refer to "12.3. Setting Upper Limits and Lower Limits" to set upper limit value and lower limit values.
- 3. With the steps described in "10.1. Storing Unit Weight", unit weight, upper limit value, and lower limit value are stored together.
- 4. With the steps described in "9.6. Unit Weight by ID Number", unit weight, upper limit value, and lower limit value are called up together.

10.5. Call Up Unit Weight Together with Comparator Upper Limit Value, Lower Limit Value, and Tare Weight

- 1. Set function setting F BB B + CCC to " B + CCCC" (refer to "14. Functions").
- 2. Refer to "8.2. Tare Subtraction" to set tare.
- 3. Refer to "12.3. Setting Upper Limits and Lower Limits" to set upper limit value and lower limit values.
- 4. With the steps described in "10.1. Storing Unit Weight", unit weight, upper limit value, and lower limit value are stored together.
- 5. With the steps described in "9.6. Unit Weight by ID Number", unit weight, upper limit value, lower limit value, and tare are called up together.




11.1. Total (M+) Function

- □ The scale can accumulate count data manually (by pressing the M+ key) or automatically.
- □ The number of pieces accumulated and the number of additions (how many times the total was added to) can be viewed with the TOTAL key.

Adding Data Manually (by pressing the M+ key)

 When the weighing value is stable (stable mark is lit), press the M+ key. The scale accumulates the number of pieces that have been counted, and the M+ mark blinks for a few seconds.

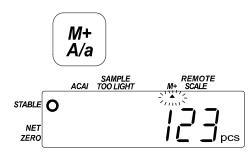


- 2. Remove counted pieces from the weighing pan. The scale cannot continuously add the same data. Before the next addition, the scale needs to return to near zero.
 - □ When the scale has accumulated data, the M+ mark lights up.
 - □ If the scale beeps four times and the M+ mark does not blink, refer to the following note.
 - □ The M+ key is usually accepted only once normally when positive count data is stable. Once accepted, the next accumulation cannot be done until the scale returns to near zero.
 - □ The scale cannot accumulate data at near zero.

NOTE

- □ If function setting F-□∃-□∂ is set to "I", the M+ key can accumulate even negative data. In this case as well, the next accumulation cannot be done until the scale returns to near zero.
- Even if data is accumulated to the total value called up from the memory, the total value in the memory is not updated. To store it in the memory, follow the procedure described in "11.5. Calling Up Unit Weight and Total Count Together".

Erasing the Last Added Data

- 1. Hold down the C key and press the M+ key.
- 2. Only the one data instance that was added last is erased from the total value.
 - If the scale beeps four times, it indicates there is no data to be erased.

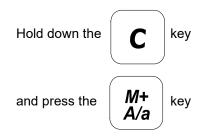

Automatic Accumulation

- The number of pieces counted can be automatically accumulated. When the weighing value is stable (when the stable mark is lit), the number is automatically accumulated and the scale beeps one time. For the next accumulation, remove counted pieces so that the scale returns to near zero.
- □ To use automatic accumulation, set function setting F-□3-□ / to " /".
- □ Automatic accumulation is operable with positive count data only. Even if function setting F-□3-□2 is set to "!" (Accept positive/negative data), the negative count data is not accumulated.

11.2. Viewing the Total Count

1. Press the TOTAL key. The scale displays the total count and the number of additions.



 
Press the PRINT key to output the total count and the number of additions.



2. Press the TOTAL key again. The display returns to normal.

11.3. Clearing the Total Count

1. Hold down the C key and press the TOTAL key.



2. The scale clears the total count, and the M+ mark turns off.



NOTE

- The RESET key does not clear the total count or the number of additions.
- □ Turning power off does not clear the total count or the number of additions.

11.4. Subtraction (M-) Function

- □ The scale can subtract (M-) count data with the * key.
- □ To use the | * | key as the subtraction (M-) key, set function setting F-□9-□ / to "/".
- □ This function does not clear the last accumulated data. It subtracts the count data and increases the number of additions.
- □ There is no function to perform automatic subtraction.

11.5. Calling Up Unit Weight and Total Count Together

- 1. Set function setting F-08-01 to "100" (refer to "14. Functions").
- 2. Unit weight, total count, and the number of additions are stored together by following the procedures in "10.1. Storing Unit Weight".
- 3. Unit weight, total count, and the number of additions are called up together by following the procedures in "9.6. Unit Weight by ID Number".
- 4. Refer to "11.2. Viewing the Total Count" to check the value that has been called up.



12. Comparator Function

The comparator function compares the number of pieces or weight with upper limit or lower limit. The comparison result is shown in 3 phases as "LO", "OK", or "HI". The buzzer can be set to ring according to the result.

Divided into three phases based on the two comparison

values of HI limit (upper limit) and LO limit (lower limit)

Red Green Yellow

LO OK HI

LO HI

limit limit

□ To use the comparator function, the function setting and upper/lower limits need to be set. For the comparator setting, refer to *F-05-X* in "13.2. Sensitivity Adjustment Using a Weight".

12.1. Setting the Comparator


□ In function setting F-05-01, set the comparison mode.

- in function setting 1 23 87, set the companion mode.		
Setting value	Description	
0	Turn off the comparator function	
Compare all data		
2	Compare stable data	
3	Compare all data except for near zero	
Compare stable data except for near zero		
5	Compare positive data except for near zero	
Б	Compare positive stable data except for near zero	

 $\hfill\Box$ In function setting F-05-02 , set the comparison data.

Setting value	Description	
0	Compare data of the number of pieces	
1	Compare data of the weight	

□ In function setting F - 05 - 03, set the buzzer to ring according to the comparison result.

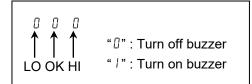

Example) 0 | 0

OK to turn on the buzzer, HI and LO to turn off the buzzer (Buzzer keeps ringing while OK)

NOTE

- The RESET key does not delete upper/lower limits.
- Turning the power off does not delete upper/lower limits.

12.2. Comparison Relation

Comparison judgment is performed with the following formulas.

Result		Judgment method		LED display
LO		Number of pieces	< LO limit (lower limit)	
		or weight	< LO limit (lower limit)	
	Number of pieces		d accomplisate of control in a manage	Red
		or weight	< Lower limit of weighing range	
ОК	LO limit (lower limit) ≤	Number of pieces	< 1.11 Um; it (
		or weight	≤ HI limit (upper limit)	Green
		Number of pieces		
НІ	HI limit (upper limit) <	or weight		
	Upper limit of weighing range <	Number of pieces		Yellow
		or weight		

12.3. Setting Upper Limits and Lower Limits 1. Press the COMP key to display upper and lower limits. COMP Press the COMP key again to return to the normal display. HI: Upper limit Lower limit -2. Set upper limit with the following keys. 000102 pcs 0 to 9 keys : Input numerical values LO: 000050 pcs Hold down the 🔻 key and : Switch + and -(Example) Set upper limit to 102 press the . key C key : Clear the input value Press the ENTER key to store upper limit and go on to input lower limit. 3. Set lower limit with the following keys. 0 to 9 keys : Input numerical values Hold down the * key and : Switch + and -(Example) Set lower limit to 98 press the . key C key : Clear the input value

Press the ENTER key to store lower limit and then return to the normal display.

Comparison starts to be judged from the top in the table shown in "12.2.

Comparison Relation".

Upper and lower limits are not judged in terms of large or small. Even if the lower limit is larger than the upper limit, an error message is not shown.

Upper and lower limits stored in the memory are not updated. To store them in the memory, follow the procedures in "10.4. Call Up Unit Weight Together with Comparator Upper Limit Value and Lower Limit Value".




13. Sensitivity Adjustment

For accurate weighing, perform sensitivity adjustment when the usage environment is drastically changed such as when the scale is initially installed or the installation site is changed. Also, to maintain a good performance, it is recommended that sensitivity adjustment be done regularly.

13.1. Preparing for Sensitivity Adjustment

- To perform sensitivity adjustment with a weight, a weight (optionally available) should be readied in advance. Power on the scale to warm it up thirty minutes or more before starting sensitivity adjustment.
- 1. Remove the cable panel.
- 2. With the display turned on, press the CAL switch. " [AL" is shown.
 - □ Holding down the TARE key also shows " [RL".

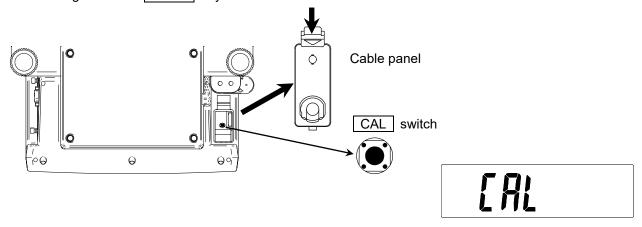

3. Select one of the following.

ZERO key : Perform sensitivity adjustment using a weight. ("13.2. Sensitivity Adjustment Using

a Weight")

Ready a weight in advance.


TARE key : Correct with the setting for gravity acceleration value ("13.3. Correcting Gravity

Acceleration")

CAL switch : Restore to factory settings ("13.4. Initializing Sensitivity Adjustment Value")

13.2. Sensitivity Adjustment Using a Weight

- 1. The scale displays both " [RL" and weight value (the value to be shown varies depending on the model). Press the ENTER key.
 - To change the weight value, use the numeric keys 0
 to 9 to enter the value. To correct the value, press
 the C key and re-enter it. The figure to the right shows an example for 5 kg.
 - Basically, use a weight that is equivalent to the capacity of scale. When using a different weight, it is recommended that it weighs 2/3 or more of the capacity.
- The scale displays " [R L G".
 With nothing on the weighing pan, press the ENTER key (sensitivity adjustment at zero point).

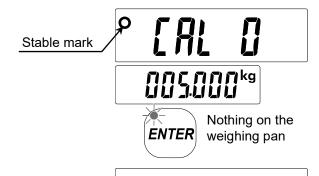

ENTER

Weight value

Stable mark

Input with a keyboard

- 3. The scale displays "[AL F".
 - For sensitivity adjustment at zero point only, press the ON/OFF key or the RESET key to exit.
- 4. Place a weight with a value the same as that shown in the display on the weighing pan, and then press the ENTER key (sensitivity adjustment for span).
- 5. The scale displays " End". Sensitivity adjustment using a weight is finished. Remove the weight from the weighing pan. The scale enters weighing mode.






- 6. Check if the scale can properly weigh in the weighing mode. Place the weight on the weighing pan again to make sure that the weight value is within the range ± 0.001/0.002/0.004/0.010 kg (GC3K/GC6K/GC15K/GC30K). If it isn't, take note of the surrounding environment and redo the procedure from step 1.
- 7. Reattach the cable panel.

13.3. Correcting Gravity Acceleration

When the scale is first used or has been moved to a different place, sensitivity adjustment needs to be performed using a weight. But if the weight for sensitivity adjustment cannot be arranged, change the gravity acceleration of your scale to the value of the area where the scale is used. The gravity acceleration setting is not required when sensitivity adjustment using a weight is performed.

- 1. The scale displays "[AL G" and the gravity acceleration value setting.
- 2. Use the numeric keys 0 to 9 to enter the gravity acceleration value.
 - □ To correct the value, press the C key and re-enter it. (Refer to "20.3. Gravity Acceleration Map")

Gravity acceleration value

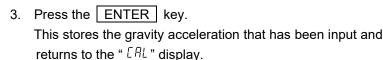



4. Turn on the display again by pressing the ON/OFF key or the RESET key.




CAL G

97985


13.4. Initializing Sensitivity Adjustment Value

When sensitivity adjustment is changed due to incorrect operation, the settings for gravity acceleration and sensitivity adjustment using a weight should be returned to the factory settings.

- 1. The scale displays "[[r[".
- 2. Every time the PRINT key is pressed, " and " and " are shown alternately.

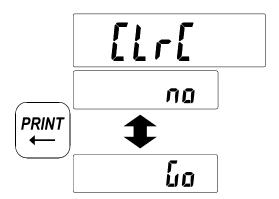

- 3. Press the ENTER key with " La" displayed to return the sensitivity adjustment value to the factory setting. After " End" is shown, the scale enters the weighing mode.
 - □ Press the ENTER key with " ¬□" displayed to show " ERL" again.

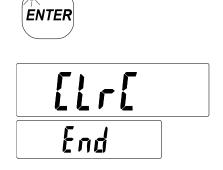



14. Functions

The functions confirms or change the items that specify scale operations. Each setting value is stored even after the power is turned off.

14.1. Function Setting

- 1. Press the ON/OFF key to turn off the display.
- 2. Hold down the ZERO key and press the ON/OFF key. When the software version β-xxx is shown, release the keys.





P- 100

3. Press the ENTER key.

On the right side of the weight display, a simplified guide is shown. If there are more items, press either the PRINT key or the TOTAL key to switch the display.



- 4. Enter the appropriate number with the keyboard to change/confirm the function setting.
 - □ For example, press the 5 key to go to the setting related to comparator function.

Function setting F-85-X: Comparator function



The function setting number is shown in the count display, and the setting value is shown in the weight display.

To change the setting : To step 6To check the setting : To step 7



- 6. Use the numeric keys 0 to 9 to change the setting value.
 - □ To correct the value, press the C key to re-enter it.
 - To finish without storing the value entered, press the
 ON/OFF key. Press the ENTER key to store the value.



- 7. Press the ENTER key to store the setting value and go on to the next item.
- 8. After changing/checking the necessary setting, press the ON/OFF key to turn off the display, and then turn it on again. The new setting is enabled.



14.2. Function List

□ "◀" indicates the factory setting.

F-00-X: Weight unit

ſ					
	F-00-0 I		□ Select the weight unit to use.		
		0		g	
		1	•	kg (the factory setting of metric model)	
		2	•	lb (the factory setting of non-metric model)	
	* {	3		OZ	
		4		ozt	

^{*} This item is only displayed on models corresponded to this function, isn't displayed on other models.

F-00-02	☐ Unit weight (when "lb" is selected)	
	0 ◀	Ib as piece weight.
	1	Ib as 1,000 piece weight.

F-01-X: Unit weight

	F-01-01	□ Key lock		
			◄	All keys are enabled.
	,		Keys are enabled only for counting by registering samples. Keys for other counting	
		1		operation are disabled.

F-01-02	□ Ford	□ Forced unit weight registration with "Add##" (insufficient samples)		
	Whe	When the sample weight is insufficient and "Add##" to add samples is displayed, set		
	whe	ther or not the unit weight can be registered without samples being added. Or, set to		
	not	display "Add##".		
	0	Even light unit weight can be registered without "Add##" to add samples being		
	U	displayed.		
	1 •	The unit weight can be registered without additional samples even if "Add##" is displayed, with the ENTER key.		
	2	The unit weight cannot be registered without additional samples if "Add##" is		
	E	displayed.		

	F-01-03	□ Minimum countable unit weight (d = minimum display)			
			Eve	n if the setting is changed, counting accuracy is not improved.	
		0	◄	1/5d	
		1		1/100d	

F-01-04	(one weight when the display is on	
	5	et whether or not to start with the unit weight reset or with unit weight used last, when	
	the display is on.		
	0	■ Unit weight has been reset.	
	1	Start with the unit weight used last.	

F-01-05		AIS	function
		Whe	en placing a load, automatically call up a unit weight that is close to the weighed value
		(refer to "9.6.3. AIS Function").	
	0	⋖	Disable the function.
	1		Enable the function.

F-02-X: ACAI function


F-02-0 I	□ ACA	□ ACAI operation when the unit weight is registered with samples		
	0	ACAI does not operate.		
		ACAI automatically operates.		
	2	ACAI manually operates (with the ENTER key being pressed).		


F-⊕2-⊕2 □ ACAI operation when the unit weight is called up with the		Al operation when the unit weight is called up with the numeric keys or from ID memory
	0	ACAI does not operate.
		ACAI manually operates (with the ENTER key being pressed).
	◀	However, when F-@2-@ / is set to "@", the setting of F-@2-@ / is prioritized and
		ACAI does not operate.
	2	Follow the F-02-0 / setting.

F-03-X: Total (M+) function

F-03-0 I		Auto	matic operation/manual operation
	0	◄	Manual addition (with the M+ key)
	1		Automatic addition (only positive data can be added)

F-03-02		Pola	rity of data to add (additions with the M+ key only)
	0	◄	Add positive data only (except for zero range)
	1		Add positive/negative data (except for zero range)

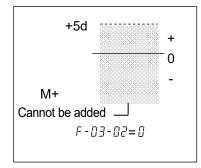

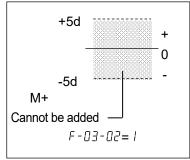

F-04-X: Scale setting

F-04-X: Scale	e seuing
F-04-01	□ Zero tracking function
	Automatically follow the gradual variation of zero point that generates due to
	environmental change
	Disable the function.
	├ I Enable the function.
F-04-02	□ Response characteristics
	Response is fast/weak to vibration (good environment, weighing)
	☐ Display where response is slow/stable (stability is prioritized)
F-04-03	□ Stable detection
	Detect fast (good environment)
	☐ Detect slow (stability is prioritized)
	
F-04-04	□ Buzzer
	Turn on/off the buzzer when operating keys
	U Turn off
	│
F-04-05	□ Automatic power-off
	Turn off the display after a preset time passes when the weighed value is stable and keys
	are not operated.
	☐ d Disable the function.
	5 minutes
	2 10 minutes
	3 15 minutes
	4 30 minutes
	5 60 minutes
	le
F-04-06	□ Automatic power-on
	☐ ■ Disable the function.
	Enable the function.
5 84 83	
F-04-07	□ Decimal point
	□ d Dot
	Comma

F-04-08	□ Power source			
	☐ ◀ AC adapter			
	/ Battery			
	Dattery			
F-04-09	□ Negative tare			
	Tare is allowed when the total amount is negative within the range of the zero point setting.			
	☐ I Disable the function.			
	Enable the function.			
-05-X: Com	parator function			
F-05-01	□ Comparison mode			
	☐ I Disable the function.			
	Compare all data.			
	Compare stable data.			
	☐ Compare all data except for near zero.			
	Compare all stable data except for near zero.			
	5 Compare positive data except for near zero.			
	5 Compare positive stable data except for near zero.			
F-05-02	□ Target for comparison			
	☐ 			
	Compare weight data			
F-05-03	□ Buzzer according to comparison result			
	(refer to "12. Comparator Function")			
	☐ ☐ ☐ ☐ ■ Turn off buzzer for any comparison result			
	Setting is required to turn on the buzzer according to comparison result.			
	Set LO, OK, or HI each to 0 or 1.			
	III			
	" / ": Turn on			

Ex.) The setting " \Box \Box " indicates turning on the buzzer with OK and turning it off

with HI and LO.

(Buzzer keeps ringing while OK.)

F-06-X: Communication setting

F-06-01	□ Data	a output mode
	<i>□</i> ◄	Key mode A (output data with the PRINT key when it is stable)
	1	Auto print mode A (Reference = zero)
	2	Auto print mode B (Reference = last stable value)
	3	Stream mode (commands are not usable)
	Ч	Key mode B (immediate data output)
	5	Key mode C (output data when stable)
	6	Auto print mode C (output data when in auto print A mode and comparison result is
	0	OK)
	7	Auto print mode D (output data when in auto print B mode and comparison result is
		OK)

		a
0 18	00 ◀	Output count data
ID PCS Weight Unit weight	00 	Set data for ID, count, weight, and unit weight with 0 or 1 to select output data. "": Do not output data "": Output data Ex.) The setting "

F-06-03	□ Con	nected devices
	0 ◀	General devices (printer, PC)
	1	AD-8561-MI
	2	External instrument

F-06-04	□ Bau	□ Baud rate		
	0 ◀	2400 bps		
	1	4800 bps		
	2	9600 bps		

F-06-05	□ Data	a length, parity
	0 ◀	7 bit, even
	1	7 bit, odd
	2	8 bit, non

F-06-06	□ Data	a format
	0 •	A&D standard format
	1	DP format

F-06-07		Com	mand reply
	0	◄	No reply to command
	1		Reply to command

F-06-08	□ Auto print polarity
	☐
	Negative only
	∂ Bipolar
F-06-09	□ Auto print width
	Ü ◄ 10d
	100d
F-06-10	□ Assignment of comparison result
	Assign comparison result to output data of the comparison target $(F - \square 5 - \square 2)$.
	☐
	Enable the function
F-06-11	□ Assignment of date and time
	Use date and time in the calendar function for the AD-8127 (output <esc>D, <esc> T).</esc></esc>
	Set the print mode for the AD-8127 to "Dump print mode".
	☐
	Enable the function
F-06-12	□ Data output intervals
	Set intervals for continuous data (approximately 2 seconds)
	☐
	Enable the function
F-06-13	□ UFC function
	☐ ✓ Disable the function
	Enable the function
F-07-X: Pass	word lock function
F-07-01	□ Require the administrator's password registered in "Password Registration" to change
	the function setting. Although the function setting can be changed without a password,
	the items that can be set are limited.
	☐
	Enable the function

F-08-X: Memory

	1 9		
F-08-0 I	□ Items to call up from ID memory		
	000 ◀	Unit weight (and item code) only	
		Set data for total, upper and lower limits, and tare with 0 and 1 to	
000		select items to call up.	
	Total 🗂 🗂	"ິມ": Not to call up	
Upper and lower	Iimits ————————————————————————————————————	" / ": Call up	
		Ex.) The setting "[] []" calls up unit weight (and item code) and upper and	
		lower limits.	

F-08-02	□ Select internal memory or external memory
	☐ Internal memory
	External memory


F-09-X: Function assignment

F-09-01	□ *	key operation
	0 ◀	Switch ID and item code.
	1	Operate as the M- key.

F-09-02	□ Dis	play switch	
	0 ◀	Main display: Count	Sub display: Weight
	1	Main display: Weight	Sub display: Count

F-10-X: External input terminal

		'				
F-10-01	□ F-;	ʿŪ - Ū 付: Key to assign to external input signal #1				
F-10-02	F - IŪ-Ū∂: Key to assign to external input signal #2					
	Rea	Ready a 3.5 mm stereo mini plug (not included in the package) and connect it to a switch,				
	etc.	It works by short-circuiting #1 or #2 with GND (100ms or greater).				
	0 ◀	RESET (the factory setting of F - ID - D I)				
	1 •	F = IB = B = IB = B = IB = IB = IB = IB				
	2	TARE				
	3	ZERO				
	4	SAMPLE				
	5	REMOTE SCALE				
	Б	5 TOTAL				
	7	M+				
	8	PRINT				

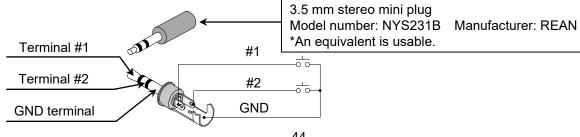

14.3. Password Lock Function

The password lock function limits browsing and changing the function settings of the scale. At the factory setting, the password lock function is disabled. Set to enable/disable the password lock function and to register a password based on the following table.

Function setting Setting value		Description
F-07-01	0	Disable password lock
r-u1-u1	1	Enable password lock
PRSSno		Register password

14.3.1. Password Registration


- 1. Press the ON/OFF key to turn off display.
- 2. Hold down the ZERO key and press the ON/OFF key. When the software version P-xxx is shown, release the keys.
- 3. Press the ENTER key to display "F-00".
- 4. Use the numeric key 9 to display "F-99". Press the ENTER key.
- 5. The scale displays "PR55no" and the password (4-digit numbers). The default password is "0000".
- 6. Use the numeric keys 0 to 9 to enter the password to register. (The figure to the right shows an example for password = 1234)
- 7. Press the ENTER key to return to the software version ρ -xxx after " $\epsilon \rho d$ " is shown.

 








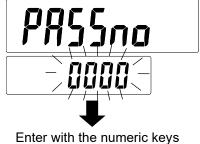





14.3.2. Function Setting after Password Lock

- 1. Press the ON/OFF key to turn off display.
- 2. Hold down the ZERO key and press the ON/OFF key. When the software version β --xxx is shown, release the keys.



and press the OFF key

ENTER

- 3. Press the ENTER key.
- 4. Press the PRINT key to select "Adn in" or "GUESE". For the difference between "Adn in" and "GUESE", refer to the table below.

	Limitation of function settings	Password
Rdn in	No	Necessary
GUESE	Yes	Not necessary



ENTER



Ada in

Changing Function Settings as Adn in


- 1. Press the PRINT key to select "Adn in".

 Press the ENTER key.
- 2. "PR55"d" is shown. Use the numeric keys 0 to 9 to enter a password.

3. Press the ENTER key.

If the password is correct, the scale displays " and then " F - 00". Change the setting value by following the steps in "14.1. Function Setting".

If the password is wrong, the scale displays "FR L" and then return to " $Rd\bar{\rho} L\bar{\rho}$ ".

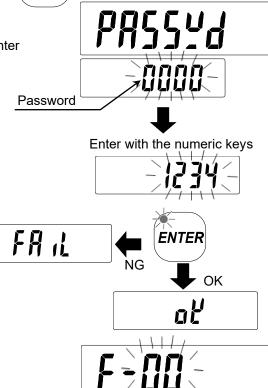

Changing Function Settings as GUESE

1. Select "GUESE" with the PRINT key and press the ENTER key.



2. "*F* - □□" is shown.

Follow the steps in "14.1. Function Setting" to change the setting value. As guest, only F-02-X, F-03-X, F-04-X, and F-05-X are changeable.



14.3.3. If You Forget Your Password

If you forget your password, the setting needs to be initialized.

Refer to "14.4. Initialization of Function Settings" to initialize the setting.

After it is initialized, function settings and comparator values are also reset and need to be set up again.

14.4. Initialization of Function Settings

The values of the individual function settings can be reset to the factory settings with the following operation.

- Password, comparator upper limits and lower limits, total value, and UFC program command are also reset.
- 1. Press the ON/OFF key to turn off display.
- Hold down the ZERO key and press the ON/OFF key.
 Release the ON/OFF key and keep holding down the ZERO key.
- and press the OFF key

 Keep holding down the ZERO key

 (Release the ON/OFF key)


ZERO

key

Hold down the

- 3. "[Lrf" is shown.

 Release the ZERO key.
- 4. Every time the PRINT key is pressed, " σσ" and " ωσ" are alternately shown.
- 5. Press the ENTER key with " [o" shown to reset the values of the function settings to their factory settings. After " End" is shown, the software version in "14.1. Function Setting" is displayed.
 - □ Press the ENTER key with " □□" shown to display the software version without initialization.

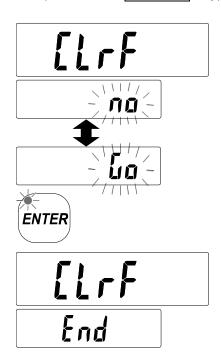



PRINT



15.1. ACAI Function

When unit weight is calculated, the larger the number of samples are, the less error is caused because variation in weight per sample is averaged. However, it is difficult to precisely count a large number of samples. With the ACAITM (Automatic Counting Accuracy Improvement) function, counting can be started with a small number of samples. And each time samples are added within the range that does not cause counting errors, unit weight is re-calculated and updated.


Precautions for using ACAI

- □ Make sure to use the ACAI function after registering unit weight. Also, leave samples on the weighing pan.
- Do not remove samples from the weighing pan until ACAI operations are finished.
- □ There is no need to precisely count samples to add. The range of addable number of pieces is that where the ACAI mark lights up.
- Repeatedly perform ACAI operations up to near the maximum number of pieces to count.
- Even if the same samples are to be counted, to precisely count them, keep registering the sample and performing ACAI operations every time.
- □ If unit weight is set with the numeric keys or unit weight is called up from memory, it is regarded that 10 samples are registered. With the factory setting, operations are performed manually (with the ENTER key). To switch to automatic operation, set function setting F-02-01 to "1", and F-02-02 to "2".

15.2. Automatic Operation of ACAI


1. Before performing ACAI operations, register a unit weight. Leave samples on the weighing pan.



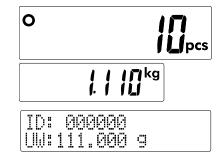

- 2. Add samples within the range where the ACAI mark lights up (refer to the table on the next page).
 - □ The ACAI mark lights up within the range where ACAI is possible.
 - As a rough standard, about the same number of pieces as that which is shown in the display can be added.



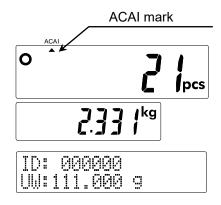

Range where ACAI is possible

Current number of pieces	Number of pieces after
Current number of pieces	being added
10	13 to 26
20	23 to 49
30	33 to 70
40	43 to 89
50	53 to 106

Current number of pieces	Number of pieces after being added		
60	63 to 122		
70	73 to 138		
80	83 to 152		
90	93 to 166		
100	103 to 299		
200	203 to 492		





Stable

ACAI

Δ

When within the range where ACAI is possible, the ACAI mark lights up.

After samples are added and the weighing value becomes stable, the stable mark lights up and the ACAI mark blinks. Unit weight is re-calculated, and the ACAI mark turns off.

- 3. When the number of pieces is within the range where ACAI is possible with the weight value stable, ACAI is performed automatically.
 - □ When unit weight is re-calculated with ACAI being performed, the ACAI mark blinks and the unit weight display changes to the unit weight value that has been re-calculated.
- 4. Repeatedly perform ACAI operations until the number of samples becomes sufficient (until it reaches the number to be actually counted).

15.3. Manual Operation of ACAI

- □ ACAI operations can be performed manually. Press the ENTER key to re-calculate the unit weight.
- □ To manually perform ACAI operations, set function setting F-@2-@ / to "2".
- 1. Before performing ACAI operations, register a unit weight. Leave samples on the weighing pan.
- 2. Add samples within the range where the ACAI mark lights up (refer to the table in "15.2. Automatic Operation of ACAI").
 - □ Within the range where ACAI operations can be performed, the ACAI mark lights up.
 - As a rough standard, about the same number of pieces as shown in the display can be added.
- 3. With the weighing value stable, press the ENTER key.
 - When unit weight is re-calculated with ACAI being performed, the ACAI mark blinks and the unit weight display changes to the unit weight value that has been re-calculated.
- 4. Repeatedly perform ACAI operations until the number of samples becomes sufficient (until it reaches the number to be actually counted).



16. Communication Specifications

16.1. RS-232C Interface

- Bidirectional communication with RS-232C is available.
- A communication cable is required for connecting to DTE (Data Terminal Equipment) such as a PC, external device, etc.

AX-KO2466-200 (2m) / AX-KO2466-500 (5m)

Connector form D-Sub 9 pin (male) Transmission method

Conforms to EIA RS-232C Transmission form Asynchronous, bidirectional


Signal form Baud rate 2400, 4800, 9600 bps

> Data bits 7 bits or 8 bits


Parity EVEN, ODD (Data bits: 7 bits)

> NONE (Data bits: 8 bits)

Stop bit 1 bit Code ASCII

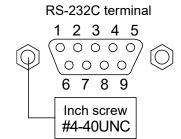


 Format for one character (when the data bits are 7 bits)



Pin layout

Pin No.	Signal name	Direction	Meaning, remarks
1		_	N.C.
2	TXD	Output	Transmit data
3	RXD	Input	Receive data
4	ı	-	N.C.
5	SG	-	Signal ground
6	DSR	Output	Data Set Ready
7	RTS	Input	Request to send
8	CTS	Output	Clear to send
9 – 7V output*		7V output*	

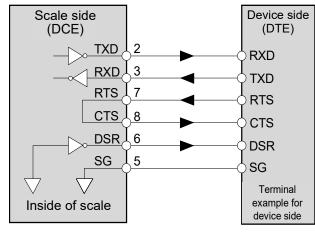

Other than TXD and RXD are the names on DTE side.

Do not connect the cables to other manufacturers' products such as a PC and PLC.

Using the wrong connection cable may damage the device. Be sure to check the compatible cable.

^{*}For use with some A&D products.

16.2. Communication Mode

For the setting related to data output, refer to F-06-X in "14.2. Function List".

A&D Standard Format



□ The two-character header indicates the data condition.

ST: Stable weight data
QT: Stable count data

US : Unstable weight or count data
OL : Weight data out of range

LO: Comparison result is LO
OK: Comparison result is OK
HI: Comparison result is HI
--: No comparison result

- □ The data is padded with polarity and zeros (filling the data's higher order's surplus part with zeros).
- □ When data is zero, the polarity is positive.
- The weight unit consists of three characters.
- □ "□" indicates a space (ASCII: 20h).
- □ The terminator is always output with <CR><LF>.

 C_R <CR> ASCII: 0Dh L_F <LF> ASCII: 0Ah

- As decimal point position and weight unit of data vary depending on the model settings, they may be different from the format example in this manual.
- Example of data format

S Т + 0 0 0 1 2 3 4 C_R L_F k Weight data g Т 0 2 3 4 Ρ Count data Q + 0 0 0 1 С C_R LF Weight data S Τ 0 Κ + 0 0 0 1 2 3 4 k C_R LF with comparison Count data Ρ Q Τ 0 Κ + 0 0 0 0 1 2 3 4 С C_{R} with comparison Weight data 0 0 0 0 2 3 4 Р С 0 L C_R L_F out of range

DP Format (Dump Print)

W	Т				+	1	2	3	4	k	g	C_R	L _F	ì
		ĺ										ĺ		
He	ader	-		D	ata					Unit	•	Terr	ninat	or

- □ This format is appropriate for printing with a dump printer such as the AD-8127.
- □ The two-character header indicates the data condition.

WT : Stable weight dataQT : Stable count data

US : Unstable weight or count data

□ When the comparison result is added (F - BE - BB is set to "F"), the header of the comparison target (F - BE - BE) becomes the following comparison result.

LO : Comparison result is LO
OK : Comparison result is OK
HI : Comparison result is HI
-- : No comparison result

- □ One data instance consists of 16 characters (terminator is not included, except for ID or item code).
- □ The polarity sign is added right before the data if the data is not overloaded or zero.

D

)a	ta Output Mode
	Key mode A When the weighing value is stable (the stable mark is lit), press the PRINT key to output data one time. At this time, the display blinks one time to notify that the output has been done.
	Auto print mode A When the weighing value exceeds the range specified by the $F - BB - BB$ (auto print polarity) and the $F - BB - BB$ (auto print width) from the reference "zero display" and the stable value mark is lit, data is output one time. When the stable mark lights up, press the PRINT key to output data one time. At this time, the display blinks one time to notify that the output has been done.
	Auto print mode B When the weighing value exceeds the range specified by the $F - BB - BB$ (auto print polarity) and the $F - BB - BB$ (auto print width) from the reference "value previously displayed with a stable value mark" and the stable value mark is lit, data is output one time. When the stable mark lights up, press the PRINT key to output data one time. At this time, the display blinks one time to notify that the output has been done.
	Stream mode This mode continuously outputs data (stream output). Data is output approximately 10 times per second.
	Key mode B Regardless of whether the stable mark is on or off, press the PRINT key to output data one time.
	Key mode C Press the PRINT key to output data one time when the stable mark lights up. When the stable mark is off, data is output one time when the mark lights up next time. At this time, the display blinks one time to notify that the output has been done.
	Auto print mode C This mode outputs data one time when the conditions for auto print A mode are met and the comparator's comparison result is OK. Also, when the stable mark lights up, press the PRINT key to output data one time. At this time, the display blinks one time to notify that the output has been done.
	Auto print mode D This mode outputs data one time when the conditions for auto print B mode are met and the comparator's


comparison result is OK. Also, when the stable mark lights up, press the PRINT key to output data one

time. At this time, the display blinks one time to notify that the output has been done.

Output Data

Specify with 0 or 1 what data out of ID, count data, weight data, or unit weight data to output.

Example: Enter 1 1 0 0 with numeric keys to output ID (and item code) and count data.

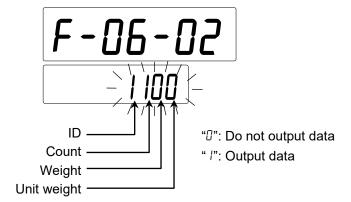

Baud Rate

Select the baud rate according to the device to connect.

- \Box 2400 bps (Set $F \Box B \Box A$ to " \Box ") Select 2400 bps to connect to an AD-8127.
- □ 4800 bps (Set *F-□*6-□4 to " | ")
- □ 9600 bps (Set *F-05-04* to "?")

16.3. Commands

By transmitting specified commands from a PC to the scale, you can control requests for weighing data, each key operation, and changes to setting values. This is usable when stream output is not performed. To transmit commands to the scale, add a terminator <CR><LF> to command strings.

Command List

Command	Function	Remarks
@	Start/stop continuous data output (stream output)	Usable during stream output
Α	Operate as the RESET key	Key command
D	Set tare weight	
Е	Store unit weight, other value, or item code in use to a	
	specified ID	
F	Call up memory of a specified ID	
G	Set unit weight	
I	Operate as the REMOTE SCALE key	Key command
J	Operate as the TOTAL key	Key command
K	Operate as the M+ key	Key command
Q	Request weighing data (output data immediately)	
S	Request weighing data (output data after weight	
3	becomes stable)	
Т	Operate as the TARE key	Key command
Χ	Output the list of function settings	
Υ	Output the contents of internal memory	
Z	Operate as the ZERO key	Key command
?ID	Output ID and item code in use	
?QT	Output count data	
?WT	Output weight data	
?UW	Output unit weight data in use	
?AQ	Output total count	
?AN	Output the number of additions	
?TR	Output tare weight in use	
?MR	Output memory of a specified ID	
MR	Store unit weight and tare weight in a specified ID	
MI	Store item code in a specified ID	
ML	Store upper and lower limits in a specified ID	
MA	Store total count and the number of additions in a	
	specified ID	
CM	Clear memory of a specified ID	
?FC	Output a specified function setting	
FC	Store setting value in a specified function setting	

Acknowledgment and Error Codes

When the scale receives commands from external devices, it responds as follows.

When a command requests certain data, the scale sends the data. For other commands,	the scale sends
acknowledgment <ak><cr><lf> to confirm command reception (with function setting</lf></cr></ak>	F-06-07) .

 $\hfill \square$ When the scale detects any abnormality, it sends the following error code.

Format of the error code

E C , E * * C _R L _F

"*" indicates an error number

Error code	Description
EC,E01	Undefined command
	Detected a command that has not been defined. Confirm the command that was sent.
EC,E02	Inexecutable
	Detected a command that cannot be executed.
	Ex.) Weighing value was requested with Q command when weighing is not displayed.
EC,E04	Excessive characters
	The number of characters for the command exceeded the acceptable value. Confirm the
	command that was sent.
EC,E05	No specified ID
	The specified ID does not exist. Specify an existing ID.
EC,E06	Format error
	The command format is not correct. Confirm the command that was sent.
	Ex.) The number of digits for the numerical value is not correct.
	Alphabet character is entered instead of numerical value.
EC,E07	Setting value error
	The numerical value of the command is out of the settable range. Confirm the numerical
	value of command that was sent.
EC,E11	Unstable weight value
	As the weighing value is unstable, zero and tare cannot be performed. Improve the condition of
	the installation site.

Data Format

The following are examples of commands. "" indicates a space (ASCII: 20h). Response indicates that it is a normal case. An error code is sent when an error occurs (refer to "Acknowledgment and Error Codes").

A command that reads from a specified ID is executed for memory that is selected with function setting F - BB - BC. A command that writes to a specified ID is executed for internal memory.

Request f	or w	eighi	ing d	lata																		
Command	Q	C _R	L _F																			
Response	ı	D	,	0	0	0	1	2	3	C_R	L _F							ID,	item	code)	
	Α	В	С	D	Ε	F	G	Н	I	J	K	L	М	Ν	0	Р	Q	R	S	Т	C_R	L
	Q	Т	,	+	0	0	0	0	0	1	2	3	П	Р	С	CR	LF	Соц	ınt da	ata		
	S	Т	,	+	0	0	0	1		2	3	4	П	k	g	CR	LF	We	ight o	data		
	U	W	,	+	0	0	0	1		2	3	4		П	g	CR	LF	Uni	t wei	ght d	lata	
The item	for o	utpu	t dat	ta fol	lows	fun	ctior	set	ting	F - []	6 - D	⊇. W	ith th	ne S	com	mar	nd, <	AK>	<cr< td=""><td>:><l< td=""><td>.F> is</td><td>3</td></l<></td></cr<>	:> <l< td=""><td>.F> is</td><td>3</td></l<>	.F> is	3
sent wher	n the	con	nma	nd is	rece	eive	d. W	hen	the v	weigl	nt is	stab	le, d	ata	is ou	ıtput	with	the	form	at a	bove) .
Set tare w	eigh	ıt (Se	et tar	e we	eight	to 1	.23	kg)	_													
Command	D	:	1		2	3	C_R	L _F														
Response	AK	C_R	L _F																			
Tare weig	ht: L	Jp to	8 di	gits	inclu	ding	dec	imal	poi	nt												
Store unit	wei	ght, d	othei	r valı	ue, c	r ite	m cc	ode i	n us	e to a	a sp	ecifie	ed IE)								
Command	Ε	:	1	2	3	CR	L _F					Sto	re ir	ID:	000	123	with	out it	em (code)	
	Е	:	1	2	3	,	а	b	С	CR	L _F	Sto	re ir	ı ID:	000	123	with	item	cod	e "a	bc"	
Response	AK	CR	L _F																			
ID: Up to 6	dig	its																				
Item code:	Up	to 20	dig	its (\	Whe	n les	s tha	an 2	0 dig	gits, e	entei	spa	ices	for t	he r	emai	ining	digi	ts)			
Call up mo	emo	ry of	a sp	ecifi	ed II)																
Command	F	,	1	2	3	CR	L _F					Cal	l up d	data	of ID	: 000	123					
Response	AK	CR	LF																			
ID: Up to 6	dig	its																				

0 -4	! !	٠ (٥ -		: 4	المادا	4- 0	400	>													
Set unit w		ı (Se		II WE	eigni	1			ı	1											
Command	G	:	0		1	2	3	C_{R}	L _F												
Response	AK	C_{R}	L_F																		
Unit weigh	ıt: Up	to 8	3 dig	its ir	nclud	ling (decir	mal p	ooint	t											
Output ID	and	itom		lo in	uco																
		ııen			1	1															
Command	?	ı	D	C _R	L _F]	ı	ı	ı		1	1									
Response	ı	D	,	0	0	0	1	2	3	CR	L _F					1 1					
ID 0 1' ''	Α	В	С	D	Е	F	G	Н	I	J	K	L	М	N	0	Р	Q	RS	T C	R LF	
ID: 6 digits		diaita	/lf	not c	ot c	ntor	one	000)													
Item code	. 20 (aigits	5 (11	HOL S	et, e	HILEI	spa	ces)													
Output co	unt c	lata																			
Command	?	Q	Т	C _R	L _F]															
Response	Q	Т		+	0	0	0	0	1	2	3	4		Р	С	C _R	L _F	Positive da	ita whe	n stable	
rtesponse	U	S	,	-	0	0	0	0	5	6	7	8]]	P	С	CR		Negative da			
	0	L	,	+	9	9	9	9	9	9	9	9		Р	С	CR		"E" is show	wn		
				•	•	•												_			
Output we	eight	data	ì																		
Command	?	W	Т	CR	L _F																
Response	S	Т	,	+	0	0	0	1		2	3	4		k	g	CR	L _F	Positive da	ita whe	n stable	
·	U	S	,	_	0	0	0	5		6	7	8		k	g	CR	L _F	Negative da	ata whe	n unstab	ole
	0	L	,	+	9	9	9	9	-	9	9	9	ı	k	g	C_R	L_F	E" is show	٧n		
Output un						1															
Command	?	U	W	CR	L _F													_			
Response	U	W	,	+	1		2	3	4	5	6	7	ı	1	g	C_R	LF]			
0																					
Output tot			ı	1	1	1															
Command	?	Α	Q	CR	L _F													_			
Response	Α	Q	,	+	0	0	9	9	9	9	9	9		Р	С	C_R	L _F]			
0				1.124																	
Output the		nber	of a	addit	ions	1															
Command	?	Α	N	CR	L _F																
Response	Α	Ν	,	0	0	0	0	1	2	3	4	C_R	L _F								
0.4																					
Output tar		_	1		ı	1															
Command	?	Т	R	C_R	L_F																

2 3 4

0 1

k g C_R L_F

Response T R ,

+ 0 0

Output memory of a specified ID

Command	?	М	R	,	1	2	3	C_R	L _F												
Response	М	R	,	0	0	0	1	2	3	,											
	Α	В	С	D	Е	F	G	Н	I	J	K	L	М	Ν	0	Р	Q	R	S	Т	,
	1		2	3	4	5	6	7	,	+	0	0	0	1		2	3	4	,		
	+	0	0	0	0	5	6	7	8	,	+	0	0	0	0	1	2	3	4	,	
	+	0	1	2	3	4	5	6	7		0	0	0	0	1	2	3	4	C_{R}	LF	l

Data is output in the following order and number of digits.

ID (6 digits), item code (20 digits), unit weight (8 digits including decimal point), tare weight (9 digits including sign and decimal point), upper limit value (9 digits including sign), lower limit value (9 digits including sign), total count (9 digits including sign), the number of additions (8 digits)

Store in a specified ID

For 3 items: Store unit weight and tare weight

For 8 items: Store item code, unit weight, tare weight, upper and lower limits, total count, and the number of additions

Command	М	R	:	1	2	3	,	1		2	3	,	0	4	5	6	C _R L _F
Command	М	R	:	1	2	3	,	а	b	С	d	,					
	1		2	3	,	0		4	5	6	,						
	+	1	0	1	0	,	+	9	9	0	,						
	+	6	7	8	9	,	1	2	3	C_R	L _F						

Response AK C_R L_F

ID: Up to 6 digits

Item code: Up to 20 digits

In the example above, "abcd_____" is stored in ID: 000123.

Unit weight: Up to 8 digits including decimal point Tare weight: Up to 8 digits including decimal point

Upper limit value: Up to 9 digits including sign (- 00999999 to + 00999999) Lower limit value: Up to 9 digits including sign (- 00999999 to + 00999999) Total count: Up to 9 digits including sign (-00999999 to + 00999999)

Number of additions: Up to 8 digits (00000000 to 00009999)

Store item code in a specified ID

Command M I : 1 2 3 , a b c d C_R L_F

Response AK C_R L_F

ID: Up to 6 digits

Item code: Up to 20 digits

In the example above, "abcd_____" is stored in ID: 000123.

Command M L : 1 2 3 , + 1 0 1 0 , + 9 9 0 C _R L _F
Response AK C _R L _F
ID: Up to 6 digits
Upper limit value: Up to 9 digits including sign (- 00999999 to + 00999999)
Lower limit value: Up to 9 digits including sign (- 00999999 to + 00999999)
Lower milit value. Op to a aigite moldaling sign (occossors to 1 occossor)
Store total count and the number of additions in a specified ID
Command M A : 1 2 3 , + 6 7 8 9 , 1 2 3 C _R L _F
Response AK C _R L _F
ID: Up to 6 digits
Total count: Up to 9 digits including sign (- 00999999 to + 00999999)
Number of additions: Up to 8 digits (00000000 to 00009999)
Clear memory of a specified ID
Command C M : 1 2 3 C _R L _F Clear memory of ID: 000123
Response AK C _R L _F
ID: Up to 6 digits
Output a specified function setting
Command ? F C , 0 5 0 1 C _R L _F Request for setting value of
function setting F-U5-U1
Response
Function setting number: 4 digits
Store setting value in a specified function setting
Command F C : 0 6 0 2 , 0 1 1 1 C _R L _F Output count, weight, and unit weight
Response AK C _R L _F
Function setting number: 4 digits
Setting value: Refer to "14.2. Function List"
The new setting will take effect when the display is turned off and on again.

Store upper and lower limits in a specified ID

Output the list of function settings

Command X C_R L_F

Response

,	F	С	,	0	0	0	1	,	1	C_R	L _F
	F	C	,	0	0	0	2	,	0	C_R	LF
	F	С	,	0	1	0	1	,	0	C_R	L _F

F	С	,	1	0	0	2	,	1	CR	L _F
EOT	C_R	L _F								

At the end of data, <EOT><CR><LF> is output.

<EOT> ASCII: 04h

Output the contents of internal memory

Command Y C_R L_F

Response

•	М	R	,	0	0	0	0	0	1	,	а	b	С	ш	ш	ш	ш	ш	1		1	1
]]	1]	1	1]]	,	1		2	3	4	5	6	7	,	+	0	0	0
	1		2	3	4	,	+	0	0	0	0	0	1	0	0	,	•	0	0	0	0	0
	0	1	0	0	,	+	0	0	0	0	0	1	0	0	0	,	0	0	0	0	0	0
	1	0	C_R	L _F	М	R	,	0	0	0	0	0	2	,	d	е	f]]]]]

0	0	0	0	0	0	0	5	CR	LF	EOT	CR	L _F
---	---	---	---	---	---	---	---	----	----	-----	----	----------------

Data stored in internal memory is output in the following order and number of digits.

ID (6 digits), item code (20 digits), unit weight (8 digits including decimal point), tare weight (9 digits including sign and decimal point), upper limit value (9 digits including sign), lower limit value (9 digits including sign), total count (9 digits including sign), number of additions (8 digits)

At the end of data, <EOT><CR><LF> is output.

<EOT> ASCII: 04h

16.4. UFC (Universal Flex Coms) Function

The UFC (Universal Flex Coms) function enables arbitrary descriptions to be output when weighing data is output.

- □ Send a program command corresponding to the output format, to the scale and make it store the command. The program command stored is held even if the power of the scale is turned off.
- □ The number of characters used for the program command is up to 1000.
- □ To use the UFC function, the UFC format needs to be stored in the scale in advance.
- □ To use the UFC function, set function F-85-13 to "\".
- □ The beginning of program command should be "PF,".
- □ The end of program command (the end of string) should be <CR><LF>.
- □ The variable command is replaced with the scale's weight data or tare data.

Example of Program Command

ample of	110	yı a	III C	-011	IIIIa	IIIU															
Command	Р	F	,	\$	Р	O	,	6	Т	Е	Χ	Т	í	,	#	2	0	,	\$	S	Р
	*	2	,	\$	С	R	,	\$	L	F	,	\$	W	Т	,	\$	O	R	,	\$	L
	F	C_R	L _F																		
Response	AK	CR	L _F	1																	

List of Variable Commands and Control Codes

Command	Description	Output example
PF,	Program command header	
	This is added to the beginning of the program command.	
<cr><lf></lf></cr>	Program command terminator	
	This is added to the end of the program command.	
\$PC	Count data	+ 1 2 3 4 _ P C
\$WT	Weight data	+ 3 . 2 1 0 _ k g
\$UW	Unit weight data	+ 1 . 2 3 4 5 6 7 _ g
\$TR	Tare data	+ 1 . 2 3 4 _ k g
\$TL	Total count	_ , + 9 9 9 9 9 9 F C
\$AN	Number of additions	1 2 3 4
\$CD	ID in use	0 0 1 2 3
\$NM	Item code in use	A B C D
\$CP	Comparator result	L O Comparison result is LO
		O K Comparison result is OK
		H I Comparison result is HI
		No comparison result
\$CM	Comma	, ASCII: 2Ch
\$SP	Space	ASCII: 20h
\$CR	<cr></cr>	ASCII: 0Dh
\$LF	<lf></lf>	ASCII: 0Ah

ASCII character strings

Enclose arbitrary ASCII code character strings in single quotation marks. Usable character strings are alphabet, numeric, and symbol. Single quotation marks in the string are shown using two single quotation marks.

Ex.) When outputting character string ABC: 'ABC' When outputting character string 'ABC': "'ABC'"

□ ASCII control code

Enter ASCII control codes with # and two characters in hexadecimal.

Ex.) When outputting <EOT> (04h): #04

Data repetition

Control codes \$SP, \$CR, and \$LF can be repeated for the number of numeric characters used for each code if * and numeric characters (up to two characters) are added after them.

Ex.) When outputting 12 spaces: \$SP*12 When outputting 9 <CR>'s: \$CR*9

Combining mark

When two or more lines of program commands are sent, it is judged that the program command continues to the next line if "&" (&<CR><LF>) is added to the end of a line.

Ex.) \$WT\$CR\$LF&<CR><LF>

- □ To separate each data, use a space or ",". Although the separation is also a part of characters to be stored, it can be omitted to reduce the number of characters. However, "," for the program command header cannot be omitted. Make sure to start it with "PF,".
- □ In the UFC format, a terminator is not automatically sent. Put a terminator code (\$CR\$LF) at the end of character data as needed.
- Put a terminator code (\$CR\$LF) immediately before the last terminator <CR><LF> of the program command. Depending on the printer or data processing software, output may be properly performed with the data format created.
- □ The scale sends an error code if there is a problem when receiving a program command. It sends <AK><CR><LF> if there is no problem.

Examples of Printing and Program Commands

PF,'ID '\$CD\$CR\$LF&<CR><LF>
'PN '\$NM\$CR\$LF&<CR><LF>
'Count'\$CR\$LF&<CR><LF>
\$SP*4\$PC\$CR\$LF&<CR><LF>
'Unit Weight'\$CR\$LF&<CR><LF>
\$SP*4\$UW\$CR\$LF&<CR><LF>
'Weight'\$CR\$LF&<CR><LF>
'Result'\$CR\$LF&<CR><LF>
\$SP*4\$WT\$CR\$LF&<CR><LF>
\$SP*4\$WT\$CR\$LF&<CR><LF>
\$SP*4\$WT\$CR\$LF&<CR><LF>
\$SP*4\$WT\$CR\$LF&<CR><LF>
SP*4\$WT\$CR\$LF&<CR><LF>
'Result'\$CR\$LF&<CR><LF>
\$SP*11\$CP\$CR\$LF<CR><LF>



17.1. Usable Type of SD Card

This product uses the following type of microSD card as external memory, with which it can call up data such as unit weight from a list file created.

Form	microSD
Card type	SDHC
File system	FAT32

- □ Format the SD card in FAT32 before use.
- Operation has been confirmed with RP-SMGA04GJK (4GB) manufactured by Panasonic.
- Operation cannot be guaranteed with all devices. Depending on the manufacturer, some SD cards may not be usable. Operation related to problems that occur with specific devices (commonly referred to as compatibility) cannot be guaranteed.
- Do not insert or remove the SD card from the scale when the display is on. Doing so may cause damage or deletion of data.
- Do not turn off power when accessing the SD card. Doing so may cause damage or deletion of data.
- Do not put unrelated data (files or folders) onto the SD card. Doing so my cause damage or deletion of data.
- Data on the SD card may be damaged or deleted due to unexpected accident. Back up data regularly to an external memory device in advance.
- A&D bears no responsibility with respect to damage or deletion of data stored on the SD card, regardless
 of the details or cause of damage or loss.

17.2. Data Format

Make a list file on the SD card in the following data format.

File type	CSV
File name	List.csv



- □ The number of characters should be within 120 per line and within 60 per cell.
- When files are edited or saved with spreadsheet applications such as Excel, numerical values can be unintentionally changed as shown below. In this case, note that format error or unintentional numeric values are generated.
 - When the number of digits is large, 4981046000001, → 4.98105E+12, the numeric value is shown in exponent notation.
 - A space is added to the end of 4981046000001, → 4981046000001, data.
 - * Excel is a registered trademark or trademark of Microsoft Corporation in the United States and/or other countries.
- Do not use a comma (,) for the item code or decimal point. It will be mistakenly recognized as separation character.

	Column A ID	Column B Item code	Column C Unit weight	Column D Tare	Column E Upper limit	Column F Lower limit	Column G Total count	Column H Number of additions
	Α	В	C	D	Е	F	G	Н
1	4981 046000001	Sample 1	1.23	0	0	0	0	0
2	4981 046000002	Sample 2	2.34	0.1	1000	500	10	1
3	4981 046000003	Sample 3	3.45	0.1	10	-10	20	2
4	4981 046000004	Sample 4	4.56	0.1	10	-10	30	3
5	4981 046000005	Sample 5	5.67	0.1	10	-10	40	4
6	4981 046000006	Sample 1	10.123	0	0	0	0	0
7	4981 046000007	Sample 2	20.456	1	200	100	100	10
8	4981 046000008	Sample 3	30.789	1	200	100	200	20
9	4981 046000009	Sample 4	100.123	1	200	100	300	30
10	4981 04600001 0	Sample 5	200.456	1	200	100	-100	40
11								

Details of Each Item


Details of	Lacii iteiii					
ID	- Numeric characters (without sign or decimal point).					
	- When it exceeds six digits, the last six digits are recognized as the ID. "4981046000005" is					
	recognized as "ID: 000005".					
	- Do not set duplicate values.					
	- "ID: 000000" is for backup and	therefore cannot b	e used.			
Item code	- Alphabet characters (upper ca	se, lower case), nu	meric characters, syml	bols.		
	- When it has less than 20 chara	acters, spaces are	added to remaining dig	jits for recognition.		
	When it has more than 20 cha	racters, the first 20	characters from the to	p are recognized as		
	the item code.					
	- If an item code is not used, do	not set anything.				
Unit	- Numeric characters (without s	- Numeric characters (without sign, with decimal point, up to eight digits).				
weight	- It is recognized as the weight	unit that is being se	elected. However, "kg"	is recognized as "g".		
	- Set a value larger than the minimum countable unit weight.					
Tare	- Numeric characters (without si	gn, with decimal po	oint, up to 8 digits).			
	- When it is called up, it is conve	erted to a value tha	t is aligned with the mir	nimum display.		
	- It is recognized as the weight unit that is being selected.					
	- Set it to 0 when it is not used.					
Upper	- Numeric characters (with sign,	without decimal po	oint, - 999999 to 99999	9).		
limit	- When the upper limit value is 1	1000 and lower limi	t value is 500, they are	recognized as follows		
value,	with the GC-3K.	,	,			
lower limit		Upper limit	Lower limit			
value	Count comparison [pcs]	1000	500			
	Weight comparison [kg]	0.1000	0.0500			
	Weight comparison [g]	100.0	50.0			
	- Set it to 0 when it is not used.					
Total	- Numeric characters (with sign, without decimal point, - 999999 to 999999).					
count	- Set it to 0 when it is not used.					
The number	- Numeric characters (without sign or decimal point, 0 to 9999)。					
of additions	- Set it to 0 when it is not used.					

17.3. Inserting SD Card


1. Turn off the display.

Loosen the two screws to draw out the power panel.

 You can see the SD card slot inside.



- Do not apply strong force or impact to the SD card or the slot. Do not bend them or wet them with water. Doing so may damage them.
- 3. Pull up the slot cover.
- 4. Insert a microSD card that has a list file to the slot.
 - The SD card has a specific orientation. Set it in the appropriate orientation, and insert it fully.
 - Do not put a label on the surface of the SD card.
 - Do not touch the metal terminal of the SD card with your hand or with other metal.
- 5. Close the slot cover.
- 6. Slide the slot cover in the direction indicated by the arrow.
- 7. Close the power panel to fasten the two screws.

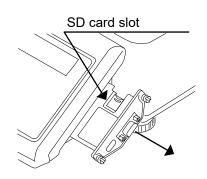










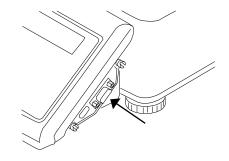

⚠CAUTION

- □ Do not open or close the power panel with the slot opened. Doing so may cause damage to the SD card and the slot.
- 8. Select " ¹" external memory with function setting F 08 02. Refer to "14. Functions"

 Data can be called up from external memory. Refer to "9.6. Unit Weight by ID Number"

17.4. Copying Data

Copy data on external memory (microSD card) to the internal memory.

- Do not turn off the power while copying data. Doing so may damage or delete data.
- □ Up to 1000 data instances can be copied. When the number of data in a list file exceeds 1000, up to 1000th data is copied.
- □ When data is copied, internal memory is temporarily completely deleted.
- □ If a format error is detected and copying canceled while in progress, data that could be read normally up to that point is copied.
- 1. Insert a microSD card that has a list file to the slot, and close the power panel.
- 2. Enter the function mode (refer to "14. Functions").
- 3. Use the numeric key 8 to display "F-88". Press the ENTER key.



4. "ΕρΡΥ" is shown. Press the STORE UNIT WEIGHT key to start copying data from external memory to internal memory (display blinks).



5. If copying is finished normally, "at is shown.

CoPY ot

☐ If copying is canceled due to format error, "FR 'L" is shown. Check the data format.

FA IL

- 6. Press the RESET key to return to "[ロロリカ]".
- 7. Confirm that there is no problem with copied data in weighing mode.

18. Options

18.1. Options List

Option name	Description
AX-KO2466-200	Cable for RS-232C, D-Sub 9 pin, 2 m
AX-KO2466-500	Cable for RS-232C, D-Sub 9 pin, 5 m
AX-TB301	AC adapter (without cable)
AX-KO7215-150	USB A to C cable, 1.5 m
GC-08	Extension cable for display, 2 m
AD-8561-MI02	Barcode reader, RS-232C, USB interface
AD-8561-MI04	Barcode reader, RS-232C, relay output interface
AD-8561-MI05	Barcode reader, RS-232C, remote scale interface
GC-14	Attachment mount (AD-8561-MI main unit holder, cable holder)

18.2. AD-8561

The AD-8561-MI02/04/05 allows the use of bar code readers, relay outputs, etc.

- □ When using the AD-8561, set function setting F-85-83 to "\".
- □ For detailed specifications, refer to the instruction manual for the AD-8561.

18.2.1. Input With Barcode Reader/Keyboard

Available with the AD-8561-MI02/04/05.

A barcode reader or keyboard can be used for ID or item code input. Upper-case/lower-case alphanumeric characters are usable.

18.2.2. Comparator Relay Output

Available with the AD-8561-MI04.

The comparator relay output is usable as a relay output for comparator comparison results. Set the upper limit/lower limit values, F - 0.5 - 0.7, and F - 0.5 - 0.7 (comparison conditions). Set function setting F - 0.5 - 0.7 (addition of comparison result) to "f".

18.2.3. Interface for Remote Scale

Available with the AD-8561-MI05.

With a load cell type of weighing platform, a two-scale system can be structured.

Sensitivity Adjustment of Remote Scale

When connecting a remote scale for the first time, set the weighing capacity and minimum display and perform sensitivity adjustment using a weight.

- Connect a remote scale via the AD-8561-MI05. Prepare a weight (separately sold) in advance. Connect the power 30 minutes or more before starting sensitivity adjustment. Turn on the display (warm up). 2. Remove the cable panel and press the CAL switch. "[AL" is shown. To cancel the operation, press the RESET key. 3. Press the REMOTE SCALE key to light up the remote scale mark (remote scale is selected). Press the ENTER key. Remote scale mark 4. Use the numeric keys 1, 2, 5, and • enter minimum display. Press the ENTER key. Minimum display 5. Use the numeric keys 0 to 9 and enter weighing capacity. Press the ENTER Weighing capacity key. The figure to the right shows an example of setting
- 6. " [RL" is shown. Weighing capacity/minimum display has been set and the remote scale is ready for sensitivity adjustment.

weighing capacity to 60.00 kg and minimum display

to 0.01 kg.

- 7. Check that the remote scale mark is lit (remote scale is selected). Refer to "13.2. Sensitivity Adjustment Using a Weight" to perform sensitivity adjustment of the remote scale.
- 8. Press the REMOTE SCALE key in weighing mode to switch to the remote scale. Confirm that it can properly weigh.

Caution When Using Remote Scale

- □ To count with an accurate unit weight, register the unit weight with a sample by using the main scale and perform ACAI. Then, switch to the remote scale.
- Perform tare subtraction with the main scale and remote scale respectively.
- □ When using a remote scale, if the unit weight is registered with the main scale and then it is switched to a remote scale, ACAI does not work. The opposite is also same.

Required Specifications of Remote Scale

- \Box A weighing platform with up to four 350 Ω load cells can be connected.
- □ The range of the remote scale's weighing capacity is from 0.001 kg to 500000 kg.
- □ When weighing capacity/minimum display exceeding 1/10000 are set, internal sensitivity per 1 d is reduced.
- Output from the weighing platform should be within the range of \pm 1.0 to \pm 3.5 mV/V when loading up to weighing capacity. The power source of load cell is 5 V.
- Input sensitivity of load cell Input sensitivity "X" of the load cell is as follows, given that rated output of the load cell is "A", its capacity is "B", and minimum display is "D".

$$X = \frac{5[V] \times A \times D}{B} \times 1000[\mu V]$$

Make input sensitivity "X" of the load cell to be 0.5 μV or greater.

With the example below, input sensitivity "X" of load cell is 1.5 µV.

Rated output of load cell A 3 mV/V
 Capacity of load cell B 100 kg
 Minimum display D 0.01 kg

□ To maintain good performance, keep the length of the load cell cable up to 5 m.

18.3. Separation of Display/GC-08

The display can be separated from the main scale. The length of cable between the display and the scale is approximately 1 m. With the GC-08 (extension cable), the length can be extended up to 2 m.

ACAUTION


- □ If the operation is done with the weighing pan facing downward, excessive force will be placed on the scale, which may cause damage.
- To reattach the display after separating it, attach it to the main scale in the reverse order. In doing so, be careful not to get the cable caught between the devices.

18.3.1. Separation of Display

- 1. Remove the power source from the scale.
- 2. Loosen the four screws from the bottom of the base and remove the cover.
- 3. Loosen the four screws and remove the display and its securing sheet.

18.3.2. Attachment of GC-08

- 1. Remove the display (refer to "18.3.1. Separation of Display").
- 2. Remove the cable clamp from the bottom of the base and remove the cable.
- Open the cable panel of display and remove the connector.
 Squeeze the cable bush on the cable panel from both sides and remove it from the cable panel.
- 4. Attach the option cable (GC-08) together with the cable bush to the cable panel the same way as the standard cable.
- 5. Attach the connectors of the option cable (GC-08) to the display and the base respectively. After attaching the connector to the base, secure the base with cable clamp.
 - Firmly attach the connector in the correct direction.
 Poor connection may prevent accurate weighing.

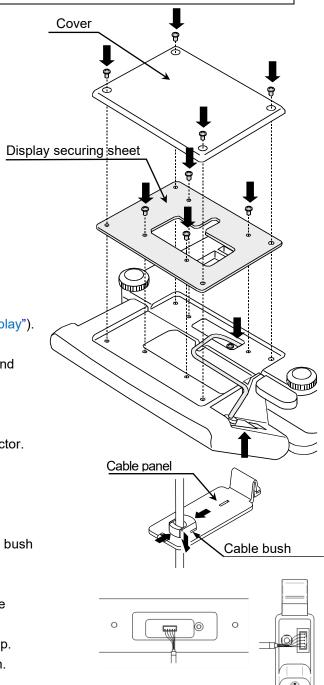

19. Maintenance

- □ Consider "4. Precautions for Use".
- □ Regularly check that weighing can be properly performed, and perform sensitivity adjustment as needed. (refer to "13. Sensitivity Adjustment").

19.1. Repair

Ask an A&D dealer for repair. Repair of the product must be performed by a qualified person only. Unauthorized repair is not covered by the warranty, and it may cause electric shock or damage.

19.2. Troubleshooting

Phenomenon	Confirmation item
The power is not turned on.	Make gure that the newer is correctly connected
Nothing is shown on the display.	Make sure that the power is correctly connected.
	□ Check if there is something touching the weighing pan.
When the display is turned on,	□ Remove everything from the weighing pan.
zero is not shown.	□ Perform sensitivity adjustment of the zero point (refer to "13.2.
	Sensitivity Adjustment Using a Weight").
The display does not change.	□ Temporarily turn off the display.
The scale cannot count.	□ Check that the unit weight has been set (refer to "9. Counting").

19.3. Error Display

Error display	Description and measures
	The weighing value is unstable.
	As the weighing value is unstable, "zero display", "sensitivity adjustment", etc.
	cannot be performed.
Error 1	□ Check if there is something touching the weighing pan.
נדוטר ו	□ Avoid breezes or vibration.
	□ Perform sensitivity adjustment of the zero point (refer to " 13.2. Sensitivity
	Adjustment Using a Weight").
	□ Press the RESET key to return to weighing display.
	Error in entered value.
Error 2	The unit weight value or tare value entered exceeds the setting range.
	Re-enter the value within the setting range.
Error 3	The memory (storage circuit) is malfunctioning. Ask for repair.
Error 4	The voltage sensor is broken. Ask for repair.
	Error in weight sensor.
Error S	□ Check if the cable between the display and scale is properly connected.
	□ The weight sensor is malfunctioning.
	Error in sensitivity adjustment.
ERL E	Sensitivity adjustment is canceled as the weight is too heavy or too light.
	Check the heaviness of the weight to retry sensitivity adjustment.

Error display	Description and measures
	Excessive loading.
ξ	The weighing value exceeded the weighing capacity. Remove everything from the weighing pan.
-E	Insufficient loading.
	The weighing value is too light. Check that the weighing pan is properly placed.
	Low power.
L b	Power supply voltage is too low.
	Check the AC adapter or power in use.
	High power.
НЬ	Power supply voltage is too high.
	Check the AC adapter or power in use.

If the errors above persist or other types of error are shown, please contact A&D customer service.



20. Specifications

20.1. Specifications List


<u>-</u>					
Model	GC-3K	GC-6K	GC-15K	GC-30K	
Weighing capacity [kg]	3	6	15	30	
Minimum display [kg]	0.0005	0.001	0.002	0.005	
[g]	0.5	1	2	5	
Weight unit	kg, g, lb, oz, ozt, pcs *3				
Number of samples	10 (5, 25, 50, 100, or arbitrary number is settable)				
Minimum countable unit weight [g] *1	0.1/0.005	0.2/0.01	0.4/0.02	1/0.05	
Repeatability (Standard deviation) [kg]	0.0005	0.001	0.002	0.005	
Linearity [kg]	± 0.0005	± 0.001	± 0.002	± 0.005	
Required time for stability	A	pproximately 1.6 se	conds (factory setti	ing)	
(under good environment)	A	pproximately 1.0 se	conds (F04-02=0,	F04-03 = 0)	
Span drift	±20 ppm/ typ. (5 °C to 35 °C)				
Operating temperature and humidity range	0 °C to 40 °C, 85 % RH or lower (no condensation observed)				
Display Count	7 segment LCD, character height 22.0 [mm]				
Weight	7 segment LCD, character height 12.5 [mm]			ım]	
Unit weight	5	x 7 dot LCD, chara	cter height 6.7 [mm	 າ]	
Icon		128 x 64	dot OLED	-	
Display refresh rate	Weight ar	nd count display: Ap	proximately 10 time	es/second	
Interface	RS-232C microSD *2				
Dower	AC adapter				
Power	Supplied from mobile battery or USB port *2				
Weighing pan dimensions [mm]	300 x 210				
External dimensions [mm]	315(W) x 355(D) x 121(H)				
Main unit weight	Approximately		Approximately	Approximately	
	4.9	kg	4.8 kg	5.5 kg	
Weight for sensitivity adjustment	3 kg±0.1 g	6 kg±0.2 g	15 kg±0.5 g	30 kg±1 g	
Accessories	Quick start guide, AC adapter, USB cable				
Main material	ABS (display, base), polyester film (display sheet), SUS430 (weighing pan), aluminum die-cast (base)				
(Molgring Pari), diaminant dio caet (base)					

^{*1} Minimum countable unit weight can be selected in the function setting.

^{*2} Operation is not guaranteed with all devices.

^{*3} If the law in your area allows, you can use these units.


20.2. External Dimensions

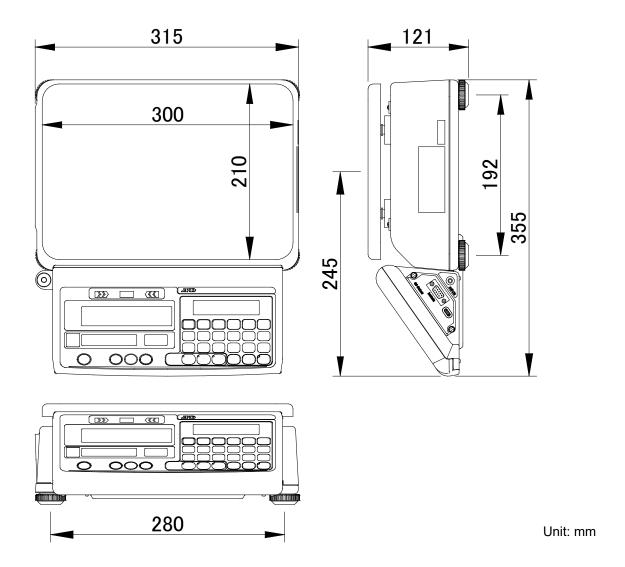


20.3. Gravity Acceleration Map

Values of gravity at various locations

Amsterdam	9.813 m/s ²	Manila	9.784 m/s ²
Athens	9.800 m/s ²	Melbourne	9.800 m/s ²
Auckland NZ	9.799 m/s ²	Mexico City	9.786 m/s ²
Bangkok	9.783 m/s ²	Milan	9.807 m/s ²
Birmingham	9.813 m/s ²	Moscow	9.816 m/s ²
Brussels	9.811 m/s ²	New York	9.802 m/s ²
Buenos Aires	9.797 m/s ²	Oslo	9.819 m/s ²
Cape Town	9.796 m/s ²	Ottawa	9.807 m/s^2
Chicago	9.803 m/s ²	Paris	9.810 m/s ²
Copenhagen	9.816 m/s ²	Rio de Janeiro	9.788 m/s ²
Cyprus	9.797 m/s ²	Rome	9.803 m/s ²
Frankfurt	9.811 m/s ²	San Francisco	9.800 m/s ²
Glasgow	9.816 m/s ²	Singapore	9.780 m/s ²
Havana	9.788 m/s ²	Stockholm	9.819 m/s ²
Helsinki	9.819 m/s ²	Sydney	9.796 m/s ²
Jakarta	9.781 m/s ²	Taichung	9.789 m/s ²
Kolkata (Calcutta)	9.788 m/s ²	Taipei	9.790 m/s ²
Kuwait	9.793 m/s ²	Tokyo	9.798 m/s ²
Lisbon	9.801 m/s ²	Vancouver, BC	9.810 m/s ²
London (Greenwich)	9.812 m/s ²	Washington DC	9.801 m/s ²
Los Angeles	9.797 m/s ²	Wellington NZ	9.803 m/s ²
Madrid	9.802 m/s ²	Zurich	9.808 m/s ²

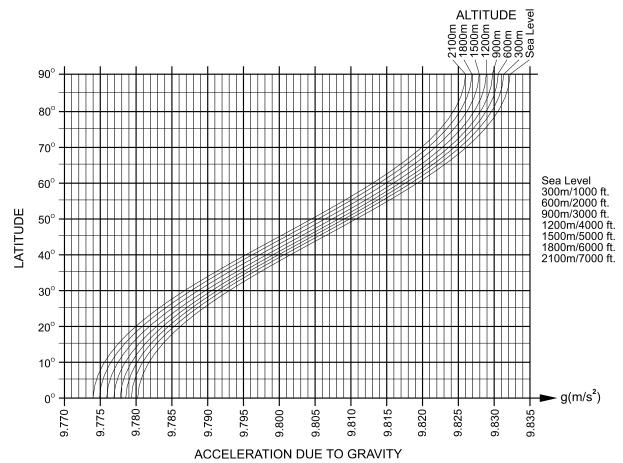

World map

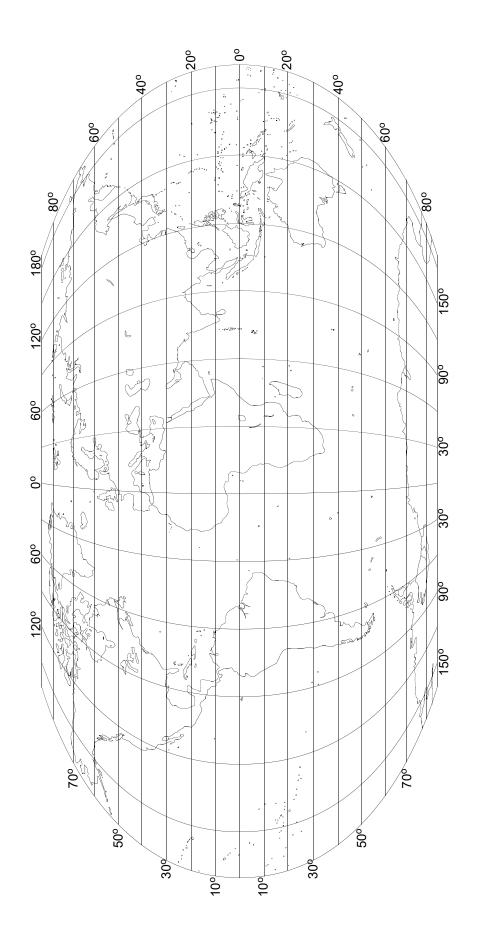



A&D Company, Limited

3-23-14 Higashi-Ikebukuro, Toshima-ku, Tokyo 170-0013, JAPAN Telephone: [81] (3) 5391-6132 Fax: [81] (3) 5391-1566

A&D ENGINEERING, INC.

47747 Warm Springs Blvd, Fremont, California 94539, U.S.A.

Tel: [1] (800) 726-3364 Weighing Support: [1] (888) 726-5931 Inspection Support: [1] (855) 332-8815

A&D INSTRUMENTS LIMITED

Unit 24/26 Blacklands Way, Abingdon Business Park, Abingdon, Oxfordshire OX14 1DY United Kingdom

Telephone: [44] (1235) 550420 Fax: [44] (1235) 550485

A&D AUSTRALASIA PTY LTD

32 Dew Street, Thebarton, South Australia 5031, AUSTRALIA Telephone: [61] (8) 8301-8100 Fax: [61] (8) 8352-7409

A&D KOREA Limited

한국에이.엔.디(주)

서울특별시 영등포구 국제금융로6길33 (여의도동) 맨하탄빌딩 817 우편 번호 07331 (817, Manhattan Bldg., 33. Gukjegeumyung-ro 6-gil, Yeongdeungpo-gu, Seoul, 07331 Korea) 전화: [82] (2) 780-4101 팩스: [82] (2) 782-4264

OOO A&D RUS

ООО "ЭЙ энд ДИ РУС"

Почтовый адрес:121357, Российская Федерация, г. Москва, ул. Верейская, дом 17 Юридический адрес: 117545, Российская Федерация, г. Москва, ул. Дорожная, д.3, корп.6, комн. 8б

(121357, Russian Federation, Moscow, Vereyskaya Street 17) тел.: [7] (495) 937-33-44 факс: [7] (495) 937-55-66

A&D Instruments India Private Limited

ऐ&डी इन्स्ट्रयमेन्ट्स इण्डिया प्रा० लिमिटेड

509, उद्योग विहार , फेस –5, गुड़गांव – 122016, हरियाणा , भारत

(509, Udyog Vihar, Phase-V, Gurgaon - 122016, Haryana, India) फोन : [91] (124) 4715555 फैक्स : [91] (124) 4715599

A&D SCIENTECH TAIWAN LIMITED. A&D台灣分公司 艾安得股份有限公司

台湾台北市中正區青島東路5號4樓

(4F No.5 Ching Tao East Road, Taipei Taiwan R.O.C.)

Tel: [886] (02) 2322-4722 Fax: [886] (02) 2392-1794

A&D INSTRUMENTS (THAILAND) LIMITED บริษัท เอ แอนด์ ดี อินสทรูเม[้]นท์ (ไทยแลนด์) จำกัด 168/16 หมู่ที่ 1 ตำบลรังสิต อำเภอธัญบุรี จังหวัดปทุมธานี 12110 ประเทศไทย

(168/16 Moo 1, Rangsit, Thanyaburi, Pathumthani 12110 Thailand)

Tel: [66] 20038911